

SURVEY & REMONUMENTATION

FEB 26 2001

FILED

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

2000 OCT 30 A 9:21

For corners in

Livingston
(County)

Located In:
Cohoctah Twp.

Corner Code

HANCY HAVILAND
REGISTER OF DEEDS
LIVINGSTON COUNTY, MI.
48843

1. Public Land Survey

T 4N R 4E I-6

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. Recorded Plat

5. Private Claims

LSC #1327m

Register of Deeds Stamp & File Number

I, John H. Rauser, P.S., in a field survey on July 10 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5							3	2		1	
3													
4	7	8	9						10	11		12	
5													
6	18	17	16						15	14		13	
7													
8	19	20	21						22	23		24	
9													
10	30	29	28						27	26		25	
11													
12	31	32	33						34	35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

I-6 Common 1/4 Corner, Sections 14 & 15, T4N-R4E, Cohoctah Township, Livingston County

In 1823, wood post placed during the original government survey by Sylvester Sibley, Deputy Surveyor. Two witness trees were marked at this time: N59W 63 lks (41.58') 16" B. Oak and N79E 63 lks (41.58') 9" B. Oak.

(Continued on Back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-6 Common 1/4 Corner, Sections 14 & 15, T4N-R4E, Cohoctah Township, Livingston County


Found no evidence of original government corner. Found 5/8" rerod 1' + South of fence line to the West, tree line to the South, centerline of road to the North. Verified the position of the found rerod with witnesses and measurements (see back) from 1973 to present. Found no conflicting evidence in the vicinity of this position. We recommend that the found 5/8" rerod be accepted as the best available evidence of the position of the original government corner and be replaced with a standard Livingston County monument with brass cap and carsonite post.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-6 Common 1/4 Corner, Sections 14 & 15, T4N-R4E, Cohoctah Township, Livingston County

Set standard Livingston County monument with brass cap stamped "I-6 39096".

North 31.70' Found nail & "Alpha" cap #11495 in East face of 10" Oak
N40E 15.90' Found nail & "Alpha" cap #11495 in Southeast face of 10" Oak
West 22.50' Found nail & flag in North face of 6" wood fence post
West 41.78' Set nail with Livingston County Survey Witness Tag in South face of Power Pole
S10W 13.10' Found nail & flag in East face of wood fence post (post leaning westerly)
S45E 19.93' Set nail with Livingston County Survey Witness Tag in Southwest face of 10" Cherry
South 0.95' Set Carsonite Witness Post

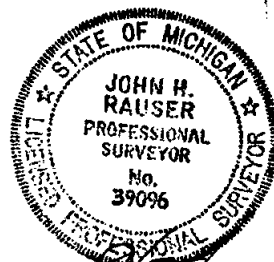

Signed by

Surveyor's Michigan License No. 39096

Date 1/25/00

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

P.A. 345 1990, APPROVED BY LIVINGSTON COUNTY

PEER GROUP ON 6-21-2000 CO. REP JED

REVISED MAY 14, 1976
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1995