

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

MAR 17 2000

For corners in

Macomb (County)	Located In: Clinton Twp.	Corner Code #
1. Public Land Survey	T 2N R 13E	J-09
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

117 SECTION  
LIBER 9275 PAGE 523  
01/04/2000 09:29:18 A.M.  
MACOMB COUNTY, MI  
CARMELLA SABAUGH, REG/DEEDS

Register of Deeds Stamp & File  
Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Michael S. Hoben, in a field survey on April 16, 1999  
do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points  
mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required  
in the current manual of survey instructions of the United States Department of the Interior, Bureau of  
Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines  
3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by  
a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed  
below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded  
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

J-09 1817 GLO Notes	Wampler	NA	Set Post
1955 "Metropolitan Beach Sub"	L.33, P.34	NA	
1956 "Harper Beach Sub"	L.36, P.16	NA	
1962 "Clinton Harper Sub."	L.51, P.8	NA	
1965 "Clinton Harper Sub. 2"	L.56, P.14	NA	
1968 "Clinton Harper Sub. 3"	L.59, P.9,10	NA	
1977 MDOT witnesses	E. Miller	13589	¾" pipe
1977 LCRC L. 2872, P. 66	Douglas W. Hooth	7966	¾" pipe

ACCEPTED BY THE MACOMB COUNTY SURVEY PE  
GROUP AS THE OFFICIAL CORNER UNDER MICHIG  
PUBLIC ACT 345 OF 1990 AT A MEETING HE  
ON 10/26/99  
William E. Soderberg  
WILLIAM E. SODERBERG, P.S., CHAIRMAN

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-09 I found a 3/4" pipe in median of Metro Parkway (conc.) in line with a wall to the north.  
Distance J-09 to I-09 (2640' R GLO) (2693.34' R 1977 MDOT) (2693.16' M)

L.C.R.C. L.2872, P.66  
NE 21.83' drill hole in chiseled square on the S edge of W Metro Parkway (m. 21.83')  
NE 152.13' SW corner of brick wall (m. 151.92')  
SW 37.92' drill hole in chiseled square in the N edge of E. Metro Parkway (m. 37.96')  
SW 141.92' nail in the W side of Power Pole (m. 141.98')


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-09 I replaced the found ¾" pipe with a 4" x 48" concrete monument w/2" diameter aluminum cap stamped "Macomb  
County Monument MI Act 345 #35994.

N 01° E 151.92' SW corner of 5' conc. wall.  
N 01° E 21.83' Found drill hole in a chiseled square on the S. edge of W. bound Metro Parkway.  
N 50° E 128.36' Set " + " on SW rim of Sanitary Manhole cover.  
S 05° E 211.47' Set Mag nail w/Remon tag on N. face 10" Maple.  
S 06° W 141.95' Found nail w/MDOT tag W. side Power Pole.  
S 06° W 37.96' Found drill hole in N. side E. bound Metro Parkway.

The selected location is accepted by me and is generally accepted by Professional Surveyors as the best available evidence of the origin  
corner.

Signed by Michael S. Hoben  
Surveyor's Michigan License No. 35994

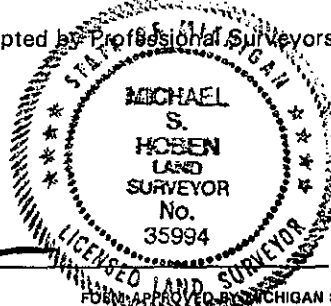

Date Dec 27 1999