

SURVEY &  
REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE  
APR 28 1995 FILING REQUIREMENT OF ACT 74, MICH. P.A.1970  
COMMISSION

FOR CORNERS OF—:

LOCATED IN—:

CORNER CODE NUMBER

1. PUBLIC LAND SURVEY \_\_\_\_\_ T. 20N N. 15W E.  
S. R. W.  
2. PROPERTY CONTROLL- \_\_\_\_\_ T. \_\_\_\_\_ N. E.  
ING IN SECTION \_\_\_\_\_ S. R. W.  
3. MISCELLANEOUS \_\_\_\_\_ T. \_\_\_\_\_ N. E.  
PROPERTY IN SECTION \_\_\_\_\_ S. R. W.

G2

Seg. 1

4. LOT NO. \_\_\_\_\_, RECORDED PLAT \_\_\_\_\_

5. PRIVATE CLAIMS \_\_\_\_\_

FILED

AT 10:10 O'CLOCK a. M.

NOV 17 1994

MARY GOLDEN KOLASKI  
MASON COUNTY  
REGISTER OF DEEDS

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on October 30 1994, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

1/4 corner common to sections 3 and 4 of T20N R15W

1839 survey by John Brink

Set Wood Post

#1 P.Pine 6 N4E 812 links

no other witnesses available.

1918 survey by C.E. Mitchell Co. Sur.

Set Concrete Monument

#2 Oak 10 N32W 96 links

#3 Oak 9 S82W 100 links

1970 survey by Robert A. Griffin #13584

Searched for and found the Mitchell monument. Replaced it w/ a 5" sq. by 36" long conc.

monument w/ brass cap.

#4 P.Post 4 West 33 feet

#5 R.Pine 7 N57E 59.46 feet

#6 R.Pine 4 S70W 54.07 feet

#7 R.Pine 4 N53W 63.68 feet

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the 5" square by 36" long concrete monument w/ brass cap by Griffin buried 5" beneath the surface and 4 feet East of the centerline of the N-S road. Witnesses 1 through 3 are gone. Witnesses 4 through 7 are in good condition. Liber 1 Page 40 by Griffin documents the history of this corner. I could find no conflicting information that would lead to another location. This monument is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1/4 corner common to sections 3 and 4 of T20N R15W

Monu. The 5" square by 36" long concrete monu. with 3" brass disk was left in place.

Witnesses:


B.Oak 11 S56E 96.36 feet

P.Post 4 West 32.88 feet (#4)

R.Pine 13 N57E 59.52 feet (#5)

R.Pine 8 S70W 53.97 feet (#6)

R.Pine 8 N53W 63.73 feet (#7)

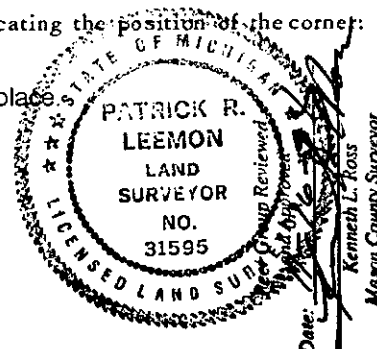

SIGNED BY

Patrick R. Leemon

October 30, 1994

DATE

31595

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_

CHIEF OF SURVEY PARTY

DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

DATE \_\_\_\_\_

(SEAL)

LIBER

3 PAGE 208

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_