

APPROVED LAND CORNER

P.A. 345 OF 1990 LAND CORNER RECORDATION CERTIFICATE
 MIDLAND COUNTY Filing Requirement of Act 74, Mich. P.A. 1970
 Midland County Remonumentation

425

STATE OF MICHIGAN
 MIDLAND COUNTY
 RECORDED

12/7/1999 2:59:31 PM

SCOTT I. HAINES
 REGISTER OF DEEDS

For Corners in
Midland

(County)

Located In:

Corner Code#:

1. Public Land Survey T. 14 R. 2W M-8
 T. 14 R. 1W A-8
 T. R.
 2. Public Controlling S. T. R.
 in Section S. T. R.
 3. Miscellaneous S. T. R.
 Property in Section S. T. R.
 4. Lot No. , Recorded Plat
 5. Private Claims

Register of Deeds Stamp & File Number

I, Mark R. Robison, in a field survey on 6-7-1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1830 Clark 1923 Gibbs, C.S.R.
 1/4 Sec Post Gas Pipe set in Survey of Sec 24
 Maple 15, N26W Greendale Twp
 W. Birch 7, S29W 2 1/2

1852 Burt 1979 Whittier
 Cor. Not Set Fd. 5/8" Rod. (No Witnesses)
 Meas. North 2639.60

1920 Gibbs, C.S.R.
 Set Oak Post
 Meas. East line of Sec 80.28

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Found 5/8" x 18" re-rod. Removed and found no other material. Meas. North 2639.72 (Rec 2639.60 in 1979 Survey) to M-7/A-7. Meas. South 2640.33 to M-9/A-9

Corner M-8, T14N, R2W and A-8 T14N, R1W were approved for remonumentation at a Peer Review Committee Meeting on 9/17/99


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 18" Gas Pipe with Brass Cap stamped "Midland County Remon, Cor. P.S. 27458" in Mon. Box. Accepted as best available evidence of the accepted position of the corner.

Witnesses:

S68°E 76.71', set spike in North Twin 12" Maple
 N61°E 95.49', set spike in 16" Maple
 S50°W 58.48', Fd spike in 16" Maple
 N67°W 37.76', set spike in 3" Maple

Signed by Mark R. Robison
 Surveyor's Michigan License No. 27458

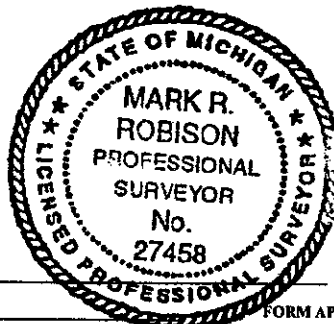

SURVEY &
 REMONUMENTATION

FEB 25 2000

SECTION

Date 11-22-99

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975
 REVISED JAN., 1983