

SURVEY & REMONUMENTATION

RECEIVED FOR RECORD

93 NOV 30 PM 1:31

JAN 27 1994

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MONROE
(County)

Located In:

Corner Code #

1. Public Land Survey

BEDFORD TWP.

MICHIGAN - OHIO

T R

LINE

T R

T R

T R

#4

2. Property Controlling in Section

S T R

S T R

3. Miscellaneous Property in Sec.

S 4 T 9S R 7E

S T R

POST 62

For Allen
REGISTER OF DEEDS
MONROE COUNTY, MICH.

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

1993 MONROE COUNTY REMONUMENTATION PROGRAM Peer Group approved corner on 11 / 08 / 1993 per Act 345 of 1990.

I, G.B. Warnke, in a field survey on 11/8, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K
2	6		5		4		3		2		
3											
4	7		8		9		10		11		
5											
6	18		17		16		15		14		
7											
8	19		20		21		22		23		
9											
10	30		29		28		27		26		
11											
12	31		32		33		34		35		
13											

A. Description of original monument and accessories and/or subsequent restoration:


Post 62 Michigan - Ohio Marker (West of the Centerline of Jackman Road)
June 2, 1837, G.L.O. Surveyor Ambrose Rice went north between Sections 3 & 4, T9S, R7E, 42.90 chains to stake on State Line. / 1915 Ohio - Michigan boundary survey set granite Post No. 62 12 1/2 feet west of the centerline of Jackman Road. / October 17, 1992, G.B. Warnke & Dean Ringle recovered monument at west edge of pavement with top 2 inches below existing asphalt. / Post was recorded in L.C.R.C., Liber 2, Page 263, by Gordon MacCammon, L.L.S. No. 10805, April 20, 1993. / Volunteer Surveyors on re-survey of Michigan - Ohio Line on January 16, 1993 observed Post 62 by G.P.S.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Post 62 Michigan - Ohio Line and witnessed as shown below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Post 62 Michigan - Ohio Line & is accepted as a careful and faithful perpetuation of the position of the original corner & witnesses:
North 15° West 98.78' PK nail in east face of telephone pole
South 40° East 63.32' top nut on hydrant
North 30° East 113.37' PK nail/shiner in southwest face of power pole
South 85° East 58.65' nail/shiner in west face of power pole
South 85° West 15.56' PK nail/shiner in east face of telephone pole

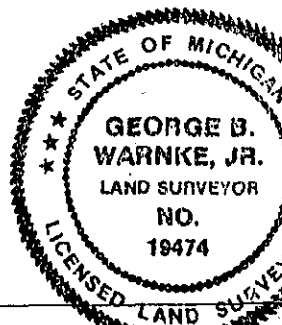

Signed by

Date 11/30/93

Surveyor's Michigan License No. 19474

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. REVISED MAY

362