1993 DEC 29 PH 4: 02

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Carrie Carty, REUSER OF DEEDS

MUSKEGON (County)	Located In:	Corner Code //
Public Land Survey	Т 9N R 15W Т R Т R	`G5
	T. R	
2. Property Controlling	S T R	
in Section	S T R .	
3. Miscellaneous	S T R	

S \_\_\_\_\_ R \_\_\_ R

Register of Deeds Stamp & File Number


- 4. Lot No. \_\_\_\_\_, Recorded Plat
- 5. Private Claims \_\_\_

Property in Sec.

For corners in

I. STEPHEN V. VALLIER in a field survey on \_SEPTEMBER\_20\_\_\_\_ 19 ... 93. do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

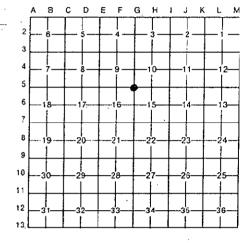

A. Description of original monument and accessories and/or subsequent restoration:

GLO CORNER SET BY J. MULLETT, 5-2-1837 N 52° W S 33° E 23 LINKS 12 LINKS

3/8" BAR-D. SCHIELE, SEC. 1991 RECORDED LBR. 1605, PG. 406

8" HEMLOCK 12" HEMLOCK IRON PIPE, M.C.R.C. 1950 NW NF. ESE SE SSE 56.71 49.221 94.6 40.81 99.551 NE SE SE NW 43.491 70.40 66.35' 56.16' P. POLE T. POLE T. POLE P. POLE

P. POLE F. POST 12" POP. T. POLE POP.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 3/8" ROD INSIDE 1" X 24" PIPE OVER 1" PIPE

N 47°E S 60°E S 65°W 43.63' 70.601 66.35' 56.16 P. POLE T. POLE T. POLE P. POLE

HISTORICAL USAGE, DOCUMENTATION & EVIDENCE OF CORNER LOCATION REVIEWED AND RATIFIED BY MUSKEGOI COUNTY PEER GROUP, AUG. 3, 1993

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET 4" X 21" CAST IRON MONUMENT WITH COUNTY SURVEY CAP (REPLACED 3/8" ROD RECORDED IN LBR.

1605, PAGE 406)

N 47°E S 60°E 43.631

S 65°W

N 52°W 56.16'

s 74° W 119.73

S 70°E

P. POLE

70.60' T. POLE 66.35 T. POLE

P. POLE

18" W. PINE

97.25'

(FD. NAIL

(FD. NAIL

(FD. NAIL

(FD. NAIL

(SET NAIL

12" R. PINE

S. SIDE)

SE'LY SIDE)

(SET NAIL

SE'LY SIDE)

e engage of

67 11:00

STEPHEN

22423

 $I \to \mathbb{R}$ 

SE'LY SIDE)

N. SIDE)

N. SIDE)

Signed by

Surveyor's Michigan License No.

28428

VALLER 1.0054 Surveyer

.. Date

ivo.

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

Dec 28 993

REVISED JAN , 1983