

SURVEY & REMONUMENTATION

LIBER 2052 PAGE 627

MAR 06 1998

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
COUNTY OF MUSKEGON
RECEIVED FOR RECORD

1997 DEC 30 PM 3:24

Carrie Carter
REGISTER OF DEEDS

For corners in SECTION
Muskegon
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---|-------------|
| 1. Public Land Survey | T <u>10N</u> R <u>17W</u> | <u>D-4</u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| 2. Property Controlling in Section | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| 3. Miscellaneous Property in Sec. | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Stanley H. Shackelford, in a field survey on July 29, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Not Set by G.L.O.

- | | | |
|------|------------------------------------|-------------------------|
| 1966 | Iron Stake by C. Lewandoski | Found 1x36-Inch Pipe |
| | South | 37.45 Feet 12-Inch Oak |
| | East/Southeast | 53.90 Feet 16-Inch Pine |
| | West/Southwest | 10.70 Feet 12-Inch Oak |
| | North | 22.95 Feet |
| 1990 | Liber 1550 Page 117 | |
| | Recorded by S. Shackelford in 1990 | |

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-4 Found 4x30-Inch Cast Iron County Survey Monument

Corner "A" Found Checks Existing Witnesses and is Confirmed by Surveys in all 4 Quarter Sections.

- | | | | |
|----------------|------------|--------------------|----------------------------|
| North 10° West | 22.95 Feet | 8-Inch Wild Cherry | Found Spike West Side |
| South 68° West | 10.70 Feet | 12-Inch Oak | Found Spike North Side |
| South 76° East | 53.90 Feet | 22-Inch White Pine | Found Spike Southwest Side |
| South 02° East | 37.95 Feet | 12-Inch Oak | Found Spike West Side |
| North 74° West | 63.40 Feet | 12-Foot Twin Oak | Found Spike South Side |


POSITION OF SAID
RECORDED CORNER
REVIEWED & RATIFIED
BY MUSKEGON COUNTY
PIER GROUP IN ACCORDANCE
WITH P.A. 345, OF 1977

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-4 Found 4" x 30" Cast Iron County Survey Monument

- | | | |
|---------|--------|-------------|
| N 10° W | 22.95' | 8" W Cherry |
| S 68° W | 10.70' | 12" Oak |
| S 76° E | 53.90' | 22" W Pine |
| S 02° E | 37.95' | 12" Oak |
| N 74° W | 63.40' | 12 Twin Oak |

- | |
|----------------------------|
| Found Spike West Side |
| Found Spike North Side |
| Found Spike Southwest Side |
| Found Spike West side |
| Found Spike South Side |

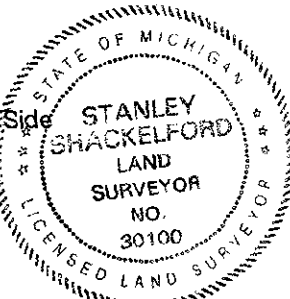

Signed by Stanley H. Shackelford
Surveyor's Michigan License No. 30100

Date December 29, 1997

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

A1935