

SURVEY & REMONUMENTATION

FEB 21 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MARQUETTE

(County)

Located In:

Corner Code #

1. Public Land Survey

T 48N R 26W

I-1

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. , Recorded Plat

5. Private Claims

I, GERALD W. CARLSON, in a field survey on December 4 TH, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-1: Corner common to Sections 2 & 3, T48N-R26W.

1845: Sam U. Hill's original subdivision survey notes describe the corner monument as a wood post being 21 links East of the corner common to Sections 34 & 35, T49N-R26W, referenced by:

35" Hemlock S43E, 16links 8" Fir S34W, 8 links

No subsequent record evidence recovered.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-1: 2000: SCA survey crews conducted a thorough search of the area and found no evidence of monumentation except a nearby Spruce tree painted blue. The GLO line calls East and West checked reasonably well. Corner position was established at the GLO offset distance and on line between the SW and S 1/4 corners of Section 35, T49N-R26W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-1: 2000: Set a 2 3/8" O.D. aluminum pipe capped with a 3 1/4" diameter aluminum tablet Marquette County Survey Monument stamped to identify the corner. Monument is 0.2' above ground. Referenced by:

16" Black Spruce N07W, 25.50'

9" Maple

N89E, 30.14'

8" Twin Maple S13W, 26.43'

12" Black Spruce

S84W, 35.83'

SW Corner Section 35, T49N-R26W S89°52'19"W, 13.85'

Green Steel Sign Post w/ Yellow Survey Marker Sign South 2.0'

Note: Bearing trees have painted face, butt, and side nail blazes, d.h. measuring nails, and stamped B.T. Tags affixed.

Bk. 16, Pg. 51 T48N-R26W Corner Search Sheet 2000035

MARQUETTE COUNTY
MICHIGAN
RECEIVED FOR RECORD

2001 DEC 22 AM 10:18

Patricia A. Monks
REGISTER OF DEEDS


LIBER **R2** PAGE **290**

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

RATIFIED BY PEER GROUP
P.A. 345 OF 1990

DATE 11/6/00

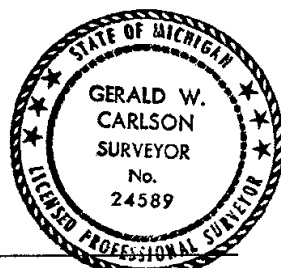

Signed by Gerald W. Carlson

Date 12-19-00

Surveyor's Michigan License No. 24589

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995