

SURVEY &
REMONUMENTATION

FEB 21 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

MARQUETTE COUNTY
MICHIGAN
RECEIVED FOR RECORD

200 DEC 22 AM 10:17

Patricia R. Monney
REGISTER OF DEEDS *pm*

For corners in

MARQUETTE

(County)

Located In:

Corner Code #

1. Public Land Survey

T 49N R 26W

F-13

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous

S T R

Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

I, GERALD W. CARLSON, in a field survey on December 4 th, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

F-13: South Quarter Corner of Section 33, T49N-R26W.

1844: Austin Burt's original Township Line survey notes of T49N-R26W, describe the corner monument as a wood post in a Stream referenced by:

8" Maple N45E, 41 links 6" Maple N10W, 22 links

No subsequent record evidence recovered.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-13: 2000: SCA survey crews conducted a thorough search of the area and found a 1/2" rebar placed next to a 3' high squared wood post. Blue paint lines running East and West were also noted.. Line calls East and West matched in some instances but not in others. Corner position was established on the latitudinal curve by single proportionate measurement between the Southeast Corner of Section 31, T49N-R26W and the Southeast corner of Section 36, T49N-R26W. Corner position lands in stream so a Witness Monument was set on line between the SW corner of Section 33 and the calculated S 1/4 corner position 60.00' horizontal distance West of the calculated 1/4 corner position.

SEE REVERSE SIDE FOR SKETCH

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-13: 2000: Set Witness Corner a 2 3/8" O.D. aluminum pipe capped with a 3 1/4" diameter aluminum tablet Marquette County Survey Monument stamped to identify the corner. Monument is 0.2' above ground and 10.6' North of North bank of stream. Referenced by:

6" Twin Maple N70W, 12.30'

4" Maple

S80E, 6.31'

5" Balsam S09E, 9.40'

4" Balsam

S76W, 32.43'

Green Steel Sign Post w/ Yellow Survey Marker Sign N03E, 2.14'

Distance from calculated corner position East 2638.37', West 2638.37'.

To calculated North 1/4 corner Section 4, T48N-R26W N89°53'40"E, 10.88'


Note: Bearing trees have painted face, butt, and side nail blazes, d.h. measuring nails, and stamped B.T. Tags affixed.

Bk. 15, Pg. 89 T49N-R26W Corner Search Sheet 2000035

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

RATIFIED BY PEER GROUP
P.A. 345 OF 1990

DATE 11/6/00

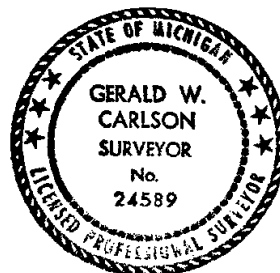

Signed by Gerald W. Carlson

Date 12-19-00

Surveyor's Michigan License No. 24589

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1983

REVISED OCT., 1995

SURVEY &
REMONUMENTATION

FEB 21 2001

SECTION

