

# SURVEY & REMONUMENTATION

JAN 09 2001

## SECTION

### LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Approved by Menominee County  
Land Survey Remonumentation  
Peer Group Under Act 345 of  
P.A. of 1990 On 12/22, 2000  
Dee Davis RLS  
Chairman

For corners in

MENOMINEE

(County)

Located In:

Corner Code #

1. Public Land Survey

T33N R 26W

B-9

T R

T R

T R

T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous  
Property in Sec.

S

T R

S

T R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, William Lenca, in a field survey on Dec., 1900 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

#### A. Description of original monument and accessories and/or subsequent restoration:

1848: Original Survey by James H. Mullett - B.T.'s - Cedar, 6" - S63°E - 16 lks.; Cedar, 12" - N16°E - 15 lks. All original evidence for this corner has been destroyed by Logging activities.

#### B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We computed the single proportional position for this corner, traversed in to it and made a careful search of the area. We found no evidence of the original corner or of subsequent restoration. We therefore set the corner at the Single Proportional location, and accepted this location as a careful and faithful reestablishment of the position of the original corner. This position fits well with a GLO terrain call to a swamp edge 2.3 chains West.

#### C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 2" dia. Aluminum Pipe 30" long/3-1/4" dia. Alum cap stamped for corner location:

7" dia. Cedar	N65°E	15.79 feet	Scr. NBT
8" dia. Cedar	S55°E	11.80 feet	Scr. NBT
6" dia. Maple	S48°W	10.71 feet	Scr. NBT
9" dia. Cedar	N05°W	10.20 feet	Scr. NBT
Metal Survey Sign Post	South	1.0 feet	


NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca

Date Dec. 20, 2000

Surveyor's Michigan License No. 26461

Bk. 6 Pg. 196

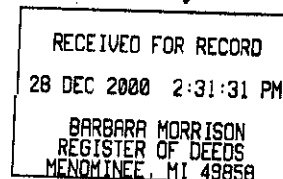

Register of Deeds Stamp & File Number

