

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In:

Missaukee

(County)

Located In

Corner Code #

1. Public Land Survey

T 24N R 8W I2

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Section

S T R

4. Lot No:

Recorded Plat:

5. Private Claims:

I, Joshua R. Davidson, in a field survey on October 8, 2013 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I2 – ¼ corner common to sections 2 & 3, T24N, R8W

- 1853 – GLO Resurvey by Whelpley – set quarter section post – 1) Nor. Pine 11" S37½°W 9 lks.
2) W. Pine 20" S70¼°E 36 lks.
- 1912 – Fargo Engineering – No U.S. evidence. Set iron and crockery – 3) Y.P. stp 12" N51½°E 0.94;
4) Y.P. stp 14" S38°W 0.28.
- 1983 – LCRC page 684, and Certificate of Survey, L. S2, P. 477 – J. Wilcox, PS #14102 – Found 1" iron pipe –
5) N70°E 34.90' 8" Maple; 6) S40°W 31.90' 8" B. Maple; 7) N40°W 47.14' 8" B. Maple.
- 1983 – LCRC page 690, and Certificate of Survey, L. S2, P. 161 – R. F. Mitchell, PS #28417 – Found 1" iron pipe by
fargo – 5) N70°E 8" Maple 34.90'; 6) S48°W 8" Black Maple 31.90'; 7) N48°W 8" Black Maple 47.14'.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I2 – ¼ corner common to Sections 2 & 3, T24N, R8W


Found 1" iron pipe with butter dish at base of pipe. Fits the stump remains of Fargo's BT's and BT's #5, 6, & 7 by Wilcox and Mitchell. No GLO evidence was found. Accepted found 1" pipe as a careful and faithful reestablishment of the position of the original corner, and replaced it with a stamped 4" DNR Aluminum Cap on 1" x 36" long galvanized iron pipe.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I2 – 4" DNR Aluminum Cap on 1" x 36" long galvanized iron pipe. – Set Blue Post 1' West.

- N70°E 34.66' to set nail & tag at found nail N. side 11" triple R. Maple (#5)
- S22°E 93.96' to set nail & tag in W. side 35" R. Maple clump of 5
- S44°W 32.00' to set nail & tag at found nail in NW. side 11" R. Maple (#6)
- N36°W 47.45' to set nail & tag at found nail in W. side 13" R. Maple (#7)

Signed by:

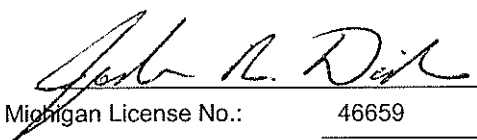

Date:

2/14/2014

Surveyor's Michigan License No.:

46659

2014-00524 L: L-7 P: 2340 LCORNER
02/14/2014 09:09:33 AM Page 1 of 1
Carolyn Flore County Recorder, Missaukee County MI



Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4			3		2		1	
3													
4	7		8		9			10		11		12	
5													
6	18		17		16			15		14		13	
7													
8	19		20		21			22		23		24	
9													
10	30		29		28			27		26		25	
11													
12	31		32		33			34		35		36	
13													

