

SURVEY & REMONUMENTATION

JAN 22 2001

Montmorency County Remonumentation

Liber 00012 Page 0445

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MONTMORENCY
(County)

Located in:
BRILEY TWP.

Corner Code #

1. Public Land Survey

T30N R 2E

F-3

2. Property Controlling
in Section

S

T

R

3. Miscellaneous
Property in Sec.

S

T

R

STATE OF MICHIGAN
MONTMORENCY COUNTY
Recorded & Filed

12-05-2000 10:07:05

TERESA WALKER
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, DONALD E MARLATT, in a field survey on MAY, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	I
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

F-3 1/4 CORNER COMMON TO SECTIONS 4 & 9.

G.L.O. COR. SET BY LEWIS CLASON IN APRIL 1840. Hd MAPLE 14" S22°E 23 L., BEECH 11' N53°W 41' L. F. SMITH NOTES(NO DATE) OLD POST WITH IRON. DELAMATER WIT. IRON GRATING N45°W 46.3', STONE S45°E 46.6', STONE S45°W 46.4', LIMESTONE N45°E 45.1'. (F. SMITH P.S.#754)

G.G. SLATTERY P.E. MSHD SURVEY CREW CHIEF 5/1967 FOUND CONC. MONUMENT BURIED 0.3' 4' WEST OF C/L OF N & S ROAD AND IN LINE WITH FENCE E & W. DUE EAST 33.99' COR. FENCE POST, N40°W 52.71' FENCE POST, S75°W 33.27' S. GATE POST, N45°E 50.06' CONC. MONUMENT.

N.C.CALDWELL P.S. #12018 NOTES OF JUNE 1973 KELLEYVILLE ROAD ALIGNMENT SURVEY FOUND 1/2"BAR & RLS CAP. SET 1/2"BAR 40' RT & LT OF FORWARD TANGENT. CONC. MONUMENT 50'NE & SW.

D.E. MARLATT P.S.# 18660 FILED ACT 132 DATED 9/18/78 RECORDED IN L. 2, P. 507. FOUND CONC. MONUMENT. EAST 33.9' FENCE POST N45°E 50.06' CONC. MONUMENT, S75°W 33.27' SOUTH GATE POST.

D.E. MARLATT P.S. ACT 132 DATED 4/20/79. FOUND CONC. MONUMENT(WIT. SAME AS ABOVE).

D.E. MARLATT P.S. ACT 132 DATED 8/15/92. FOUND CONC. MONUMENT N45°E 50' CONC. MONUMENT, S45°W 50' CONC. MONUMENT.

G.F. DELAMATER P.S.#693 (OUT OF PLACE)MAY 20, 1932 NOTES,NO DESCRIPTION OF CORNER. IRON GRATING N45°W 46.3', STONE S45°E 46.6'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner

F-3 1/4 CORNER COMMON TO SECTIONS 4 & 9.

EAST 34.1' CORNER FENCE POST R. N45°W 46.3' STEEL GRATE R. (G. DELAMATER 5/20/32).

N45°E 50' CONC. MONUMENT(BENT OVER)R. EAST 40' 1/2"ROD(CALDWELL)

S88°W 33.3' STEEL GATE POST R.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-3 1/4 CORNER COMMON TO SECTIONS 4 & 9.

PLACED REMON. CAP ON EXISTING CONC. MONUMENT.

S80°E COR. FENCE POST 34.1'

N31°W P.POLE 73.75'

S40°E FENCE POST 44.75'


S88°W STEEL GATE POST 33.30'

N45°W 46.3' STEEL GRATING

APPROVED BY
PEER GROUP

JUL 18 00

L.A.B.

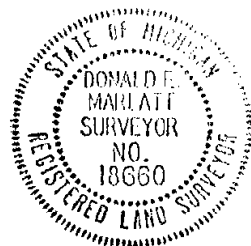

WITNESSES MARKED WITH 40 PENNY SPIKES AND P.S. TAGS#18660.

APPROVED BY PEER GROUP ON JULY 18, 2000 AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Donald E Marlatt

Date 12/4/2000

Surveyor's Michigan License No. 18660