

JAN 22 2001

Liber 00012 Page 0412

## SECTION

**MONTMORENCY COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

**For corners in**

**Located in:**

Montmorency  
(County)

**Briley**  
(Township)

**Corner Code #**

STATE OF MICHIGAN  
MONTMORENCY COUNTY  
Recorded & Filed

10-27-2000 11:56:51

TERESA WALKER  
REGISTER OF DEEDS

**Register of Deeds Stamp & File Number**

## 1. Public Land Survey

T 30N R 2E

**F - 11**

## 2. Property Controlling in Section

**S**

**T** **R**

### 3. Miscellaneous Property in Se

**\$**

**T** **R**

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

**5. Private Claims**

I, Larry G. Beauregard, in a field survey on MARCH, 20 00, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**  
F - 11 ¼ Corner between Sections 28 & 33.

1840 Lewis Clason, D.S. Set Qr. Sec. Post. Wit's mkd. (W. Pine 14" N21E 18 lks.) (Y. Pine 20" S45W 44lks.)

1977 Kenneth J. Ostling RLS #10068, (DNR Surveyor) set corner by proportionate measurement, midpoint and online, between section corners. Falls in line with fences North & South while doing a section divisional survey in Sec. 28. Filed LCRC Rec. L.1, P.208. With mkd (5° R. Pine N30E 85.4') (Cedar Post North 20') (Center E-W Rd. South 6') (10° R. Pine N12W 65.4').

1978 Donald E. Marlatt P.S. #18660 prepared Act #132 for parcels in Sec. 28. Not recorded. No corner or wit's mentioned.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

March 2000: End, Std. DNR corner, 4" aluminum cap on 1" x 36" pipe 3" below road surface. Corner left as found.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**F - 11 ¼ Corner between Sections 28 & 33.**

Std. DNR corner, 4" aluminum cap on 1" x 36" pipe 3" below road surface..

Accepted as a careful and faithful establishment of the position of the original corner.

Accepted by the peer group on July 18, 2000.

N12°W 65.40' 16" R. Pine (R)

N30°E 85.40' 10" R. Pine (R)


S34°W 57.37' 12" R. Pine (NBT)

S41°E 89.58' Power Pole (P.K. Nail)

Placed 60d penny spike & P.S. tag #18654 unless noted otherwise (typ).

APPROVED BY  
PEER GROUP

JUL 1 8 00

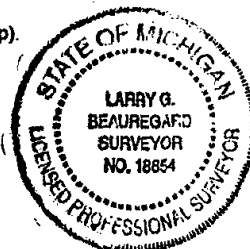

Signed by James Beauregard

Date 10-27-00

**Surveyor's Michigan License No. 18654**

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT. 1995