

# SURVEY & REMONUMENTATION

JAN 18 2001

## SECTION

### LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Oceana

(County)

Located In:

Corner Code #

1. Public Land Survey

T15N R16W

A-13

T15N R17W

M-13

T14N R16W

A-1

T14N R17W

M-1

2. Property Controlling  
in Section

S

T

R

S

T

R

3. Miscellaneous  
Property in Sec.

S

T

R

S

T

R

STATE OF MICHIGAN  
COUNTY OF OCEANA  
RECEIVED FOR RECORD

21 DEC 2000 3:18:05 PM

JOSEPH E. MERTEN  
REGISTER OF DEEDS

101012

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, J. Randolph Hepworth, in a field survey on May 24, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

A-13 CORNER COMMON TO SECTION 31 T15N, R16W ELBRIDGE TOWNSHIP AND  
M-13 SECTION 36 T15N, R17W HART TOWNSHIP  
A-1 SECTION 6 T14N, R16W FERRY TOWNSHIP  
M-1 SECTION 1 T14N, R17W SHELBY TOWNSHIP

GLO John Mullett 1838 "Set intersection cor. to Townships 14 & 15 North, Ranges 16 & 17 West"  
8" Beech N70°E 8 lks 14" Beech N61°W 14 lks

Book A, Pg. 284, H. A. Grant, 1891; Sec.6, T14N, R16W "Found a stone previously set."

Unrecorded Survey, JR Hepworth #26457, 1987 Found 1/2" Iron

Oceana County Remonumentation  
Peer Group Reviewed & Approved

Date: 11-21-00

J. Randolph Hepworth  
Oceana County Surveyor


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

I found 1/2"x18" Iron in the centerline intersection of the E-W and N-S Road. Upon excavation and removal, I did not find any other iron object. I also did not find the Grant, 1891, stone. Since this iron fits the local collateral evidence (road intersection) and since I have no other historical evidence, I accept the iron as the best available evidence of the position of the original corner. No evidence is known to me that would lead me to believe the corner should be at another location.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 4"x20" Harrison Cast Iron Monument, stamped "County Surveyor" and "26457" above the 1/2" Iron which was driven down

Set 60d spk	S Face	Power Pole	298°az	71.42'	EDM
Set 60d spk	NE Face	Power Pole	155°az	120.83'	EDM
ex. 60d spk	E Face	14" Ash	218°az	90.35'	EDM
set 60d spk	S Face	48" Maple	100°az	194.32'	EDM
set 60d spk	E Face	Power Pole	353°az	242.25'	EDM

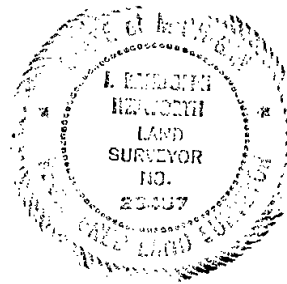

Signed by

*J. Randolph Hepworth*

Surveyor's Michigan License No. 26457

Date

December 15, 2000