

JUDITH D. ROEHM

1P

Ontonagon County

Page 1 of 1

LC 5/339

JEM Date 10/03/2000

Time 10:35:27

RECORDING FEE:

9.00

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

For corners in

ONTONAGON

(County)

Located in:

Corner Code #

1. Public Land Survey

T48N R41W

K-3

2. Property Controlling
in Section

S

T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Section Corner common to Sections 1, 2, 11, & 12, T48N R41W.
2000

I, Earl W. Applekamp, in a field survey on Sept. 20, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

Original Corner established by Wells Burt, U.S. Deputy Surveyor, summer of 1851. Set Wood Post.

ORIGINAL BEARING TREES:

18" Cedar S19°E 19 Links (12.54 Feet)
20" Cedar N59°W 11 Links (7.26 Feet)

PETER GROUP REMOVED

Earl W. Applekamp
COUNTY REPRESENTATIVE

9-27-00

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


No original evidence was found. At the calculated position there was a barbed wire fence running North and East. Champion Inc. personal had placed a tag in an oak tree in 1980 indicating the approximate corner position as N57°W, 20'. I personally knew the farmer who owned the land Northeast of the corner, who is now deceased. His son indicated the fence position has been the accepted corner. I accepted the fence corner as the most logical position for the corner.

Research on file with the Ontonagon County Remonumentation Program Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a 2½"X30" split base aluminum pipe with a 3" cap stamped to read: County Remonumentation, T48N, R41W, S1, S2, S11, S12, 2000, P.S. 17610. I established 3 bearing trees and a reference object.

Nail in 24" Oak S77°W 36.05' - Nail in 8" Oak S57°E 21.49'
Nail in 8" Oak Due North 26.51' - 6' Steel Sign Post South 0.75'

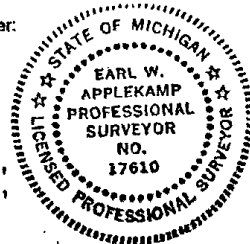

Signed by

Earl W. Applekamp

Date September 26, 2000

Surveyor's Michigan License No. _____

17610