

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Ontonagon County

LC 5/298

Page 1 of 1

JEN date 06/12/2000

Time 16:37:41

RECORDING FEE:

9.00

For corners in

Ontonagon County

Located in:

Corner Code #

1. Public Land Survey

T51N R37W B - 9

T R

T R

T R

2. Property Controlling
in Section

S

T R

S

T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

4. Lot No.

, Recorded Plat

5. Private Claims

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

I, Joseph C. Domitrovich, in a field survey on May 4, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(B - 9) ¼ Corner common to Sections 19 & 30, T51N, R37W.

1846 - S. W. Higgins, H. Higgins & B. Hubbard set ¼ post with ties:

9" Y. Birch	S 30°E	7 links
6" Sugar	N 30°W	8 links

1976 - Keith L. Sackett, P.S. 19006, Michigan D.N.R. (Recorded Corner in Liber 1, Page 60). Re-established on Line between corners East & West. Set 1" x 36" iron pipe with 4" aluminum cap.

11" Y. Birch	N 41°W	5.9'
10" Hemlock	S 33°E	13.0'
11" Sugar	N 72°E	22.8'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. I recovered the monument as set by Sackett and all 3 of his bearing trees. His Yellow Birch B.T. is dead but still standing. I added nails to the sides of his 2 live B.T.s. I accepted corner as found and added a sign rail.


Research on file with County Remonumentation Representative.

DEER GROUP APPROVED
Paul W. Applekamp 4-24-00
COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 1" iron pipe with a 4" stamped D.N.R. cap. Ties:

12" Sugar	N 75°E	23.26' (D.N.R.)
12" Hemlock	S 23°E	13.55' (D.N.R.)
16" Hemlock	S 83°W	12.97'
7" Hemlock	N 17°W	14.95'
Sign Rail	North	1.0' (To Face)
S ¼ Cor. Sec. 30	S 00°13'13"W	5376.40'
NW Cor. Sec. 30	S 88°54'52"W	2809.67' (2732.40 GLO)

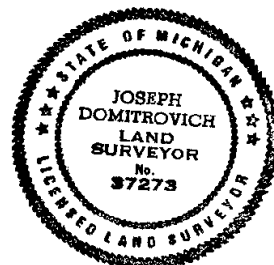

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by

Date

5/24/00

Surveyor's Michigan License No. 37273