

DEC 13 2000

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in
Osceola

Located in:

Corner Code#

1. Public Land Survey T 17 N R 7 W E-9
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on, May 31, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

E-9 - Section corner common to Sections 20, 21, 28 & 29, T17N, R7W

A. Description of original monument and accessories and/or subsequent restoration:

1848 - O. Lyon, G.L.O.

#1 - 16" Beech N15°E 19 Links

#2 - 18" Beech s67°W 39 Links

1891-1904 - F. Trumbull

"Identified by O.B.T."

Set 3" Clay Tile.

#3 - 2" B. Ash S39°E 100 Links

#4 - 10" Hemlock Stump

N41°W 40 3/4 Links

1902 - F. Trumbull

From Co. Sur. Twp. Notes - Pg. 4

#5 - Distance South 2643'

#6 - Distance East = 2699.4'

Undated from Co. Sur. Twp. Notes

Tile & Gun Barrel

#7 - Elm S25°E 42'

#8 - 18" Oak West 71.1'

1983 - J. Ray, LS 25869

L.C.R.C. Liber 02, Pg. 218.

Found 1 1/2" Iron Bar.

#9 - Cor. Fence Post N85°W 26.00'

#10 - 15" W. Pine S59°W 16.8'

#11 - Stop sign N79°E 61.23'

#12 - P. Pole S45°E 45.15'

1998 - R.L. Wetherell, LS 24624

L.C.R.C. - Liber 03, Pg. 170

Found 10 gauge double barrel shotgun over clay tile. Replaced gun Barrel with 1/2" Capped Iron.

#12 - P. Pole S37°E 44.81'

#13 - 10" W. Pine S32°W 57.88'

#14 - 10" R. Oak N54°W 50.82'

#15 - 12" R. Oak N67°E 77.81'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found my 1/2" Capped Iron directly over the 3" Clay Tile with Cinders. Corner is in the centerline of roads North, South and East and in line with old fence line to West.

Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Measured 2641.48' (in 1995), #6 Measured 2718.79' (in 1995), #7 Gone, #8 Found in good condition (32" R. Oak), #9 Found in good condition, #10 Found stump, #11 Found in good condition, #12 Found in good condition, #13 Found in good condition, #14 Found in good condition, #15 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1/2" Capped Iron with a 1" x 18" Pipe with Osceola County Remon Cap, and is accepted as a careful and faithful perpetuation of the position of the original corner.

- P. Pole S37°E 44.81' (P.K. Nail in N.E. side) #12
10" W. Pine S32°W 57.88' (60d spike in E. side) #13
10" R. Oak N54°W 50.82' (60d spike in S.W. side) #14
14" R. Oak N67°E 77.81' (60d spike in S. side) #15

APPROVED LAND CORNER
P.A. 345 OF 1990
Osceola County

R. L. W.


8-17-2000

Signed by

Robert L. Wetherell

Surveyor's Michigan License No. 24624

Date August 22, 2000

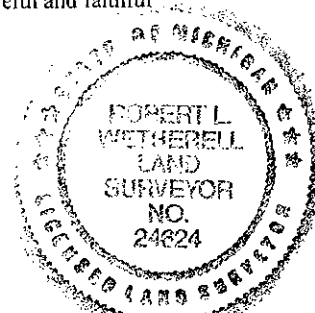

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN. 1983
ADAPTED FOR WORD PROCESSING JANUARY, 1999