

JUDITH L. ROEHM 1P  
LAND CORNER RECORDATION CERTIFICATE Ontonagon County  
Filing Requirement of Act 74, Mich. P.A. 1970 of 1 LC 5/121  
Ontonagon County Remonumentation Corner Rec. Date 08/03/98 Time 09:19  
RECORDING FEE: 9.00

For corners in

Ontonagon County Located in: Corner Code #

1. Public Land Survey T47N R38W J-3  
T R  
T R  
T R

2. Property Controlling S T R  
in Section S T R

3. Miscellaneous S T R  
Property in Sec. S T R

4. Lot No. , Recorded Plat

5. Private Claims

SECTION 2

JAN 11 1999

SECTION

Register of Deeds Stamp & File Number

I, Joseph C. Domitrovich, in a field survey on July 21, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(J-3) 1/4 Corner Common to Sections 2 & 11, T47N, R38W

1851 - Zelotes B. Searls set a post.

10" Cedar S 59° E 11 links  
18" W. Pine N 48° W 20 links

I found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original Corner or accessories. I found a 5/8" iron set by an unknown surveyor. It falls 12" below gravel at the intersection of the centerline of a county road to East and old fence line to the North and South. This 5/8" iron works well with the Section Corners to the East and West. I accepted it as the 1/4 Corner and placed a 3" diameter aluminum cap on it.

Research on file with County Remonumentation Representative.

PEER GROUP APPROVAL

Earl W. Applekamp  
COUNTY REPRESENTATIVE


7-22-98

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 5/8" iron pin with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; S.2, S.11; 1/4; T.47N, R.38W; 1998; P.S. 37273. I also established a reference monument (R.M.) to the North, a 2 1/4" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to indicate that the 1/4 Corner is S 01° E a distance of 33.30 feet.

Witnesses:

Power Pole	N 03° E	33.75' (existing nail)
16" Spruce	S 55° E	77.30'
1/2" Iron # 37273	S 00° 00' 39" E	33.00'
6" Triple Maples	S 63° W	44.64'
R.M.	N 01° 35' 21" W	33.30'
NE Cor. Section 11	N 89° 51' 30" E	2624.91'
NW Cor. Section 11	S 89° 24' 28" W	2616.67'

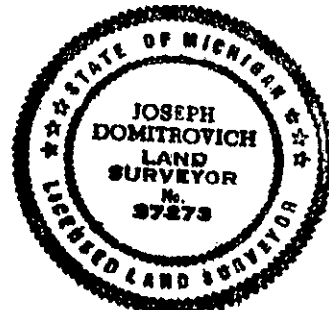

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by J. C. Domitrovich

Date 7/22/98

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995