

NOV 12 1993

Liber 6 Page 13

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED & FILED

For corners in

Saginaw

(County)

Located In:

Corner Code ##

1. Public Land Survey

T 12N R 4E

T 12N R 4E

1-4

1-5

2. Property Controlling in Section

S T R

S T R

3. Miscellaneous

S T R

Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

Nov 5 9 11 AM '93

REGISTER OF DEEDS
SACINAW COUNTY MICH.

Register of Deeds Stamp & File Number

I, Brian D Ferguson, in a field survey on September 30, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

I-4 Wood Post set by J. Wampler in 1822.
No evidence of original post exists.

I-5 Wood Post set by J. Wampler in 1822. No evidence of original post exists.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-4 Found 3/4" rod in monument box. Previous LCRC'S in L 1 Pg 266, L 1 Pg 252 and L 4 Pg 153. Two recorded surveys tie to this corner and is accepted as the best available evidence of the position of the original corner. Accepted by the Peer Review Group on 10/07/93

I-5 Found 1/2" rod in monument box. Previous LCRC's recorded in L 1 Pg 264 and L 1 Pg 252. Two recorded surveys are tied to this corner and is accepted as the best available evidence of the position of the original corner. Accepted by the Peer Review Group on 10/07/93

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-4 3" Brass Disk in monument box

I-5 3" Brass Disk in monument box

N40°W 55.73' Top ctr hydrant
N75°W 61.99' Nail & Tag S fce pwr pole
S70°E 42.18' PK nail/ ref disk S fce pwr pole
N60°E 45.72' Chisled + top ctr curb @ S. line of asphalt filled island @ S. line of U-Haul prop


N45°W 72.55' Nail & tag E fce guy pole
N45°E 79.13' Top ctr hydrant
S45°E 61.34' Nail & tag W fce guy pole
S45°W 60.91' Nail & tage E fce guy pole

Signed by

Surveyor's Michigan License No.

Date

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISION MAY 14, 1975
REVISED JAN., 1983

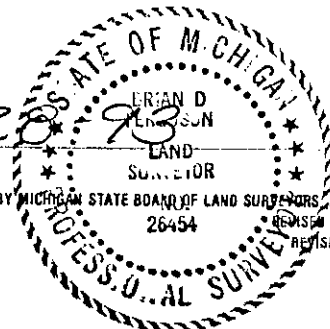

11/18/93