

SURVEY & REMONUMENTATION

DEC 02 1993

COMMISSION

1993 REMONUMENTATION PROGRAM LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 FAIRGROVE TOWNSHIP

For corners in

TUSCOLA
(County)

Located In:

Corner Code ##

1. Public Land Survey T13N R8E M-13
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. , Recorded Plat
5. Private Claims

RECEIVED FOR RECORD
LIBER NO. PAGE NO. 57
FILING NO. Fairgrove Twp.
93 NOV -2 PM 3:55
VIRGINIA M. MULLIN
TUSCOLA COUNTY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Kenneth D. Dunton, in a field survey on August 8, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1821	Feb. 16, 1859
Joseph Wampler, D.S.	D. F. Cranston, County Surveyor
Set post cor. Towns 12 & 13N-R8E	Survey of Section 36, T13N-R8E
	No mention of object found or set.
Beech 16" S2 1/2°W 13.86'	No accessories given.
Beech 14" N34°E 19.14'	Cranston meas. M-13 to M-12 of 2619.54'

Note: Section A. continued on back of form.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found and accepted 1/2" rod & cap #11192 per accessories on Act 74 forms of record.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Removed 1/2" rod & cap and placed standard monument with 2" brass cap stamped corner M-13, T13N-R8E and corner M-1, T12N-R8E.
N00°02'30"E 99.35' Set 1/2" re-rod on township line.
S89°57'30"E 60.00' set 1/2" re-rod on East ditch bank.
S03°07'E 78.44' found 5/8" re-rod (bent).
S00°03'W 78.45' found 1/2" re-rod & cap #20709.
S59°19'W 32.66' set T.C. Re-mon. tag & spike over p. k. nail in East face of t. pole.

Signed by

Kenneth D. Dunton


Date Oct. 18, 1993

Surveyor's Michigan License No. 23503

APPROVED

10-18-93

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
23503 REVISED MAY 14, 1975
REVISED JAN., 1993

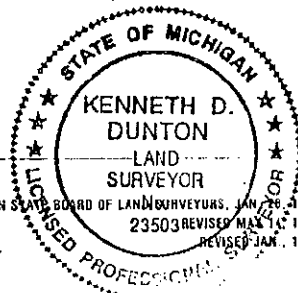

Continued from Section A. on front of this form:

April 11, 1979 Act 74, Fairgrove Township Page 40 by James L. Quist, R.L.S. #25868
Set 1/2" re-rod #11192 by single proportion method between corner M-12, T13N-R8E &
corner M-2, T12N-R8E.

S45°W 32.70' R.L.S. tag #11192 in t.p.

S35°W 29.25' center rd. sign post.

S30°E 44.95' top center of 36" CMP.

South 78.43' 5/8" rod @ SW cor. Sec. 6, T12N-R9E.

April 11, 1979 Act 74, Juniata Township Page 41 by James L. Quist, R.L.S. #25868
Information same as Act 74, T13N-R8E, Page 40.

