

SURVEY & REMONUMENTATION

MAY 10 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

WEXFORD
(County)

Located In:

Corner Code #

1. Public Land Survey T 21N R 9W 10
T R MEANDER COR.
T R EAST OF H-11
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

RECEIVED

1999 DEC -3 PM 12: 43

Linda Loughmiller
WEXFORD COUNTY, MI
REGISTERED DEEDS

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, CRAIG J. PULLEN, PS, in a field survey on JULY 28, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


- 10 1848 G.L.O. RESURVEY BY O. LYON, SET WOOD POST ON EAST SIDE OF LAKE, WHITE PINE 14 S63E 38, NORWAY PINE 30 N62 1/2 E 50, DISTANCE TO SECTION CORNER TO EAST 2376'
- 1880 A. J. TEED SURVEY IN SECTION 27, FOUND MEANDER POST EAST SIDE LAKE, W PINE 36 S12 1/2W 15, HEMLOCK 24 N26E 19
- 1971 PLAT OF OAK BEACH ESTATES, LIBER 1 OF PLATS, PAGE 245, BY JACK F. ERICKSON PS#16929 SET CONCRETE MONUMENT BY PRO-RATION TO GLO, POINT OF BEGINNING & MEANDER CORNER ON NORTH LINE OF SECTION 34, T21N, R9W, AT EAST SIDE STONE LEDGE LAKE. PLAT DISTANCE TO NE CORNER OF SECTION 34 IS 2376.19'
- 1975 JERRY L. WILCOX PS#14102 SURVEY IN SECTION 27, LIBER 1, PAGE 340, FOUND MEANDER CORNER NE CORNER PLAT OF OAK BEACH ESTATES
- 1989 FRANCIS E. FINNERTY PS#16038 SURVEY IN SECTION 34, LIBER 68, PAGE 330, MEANDER CORNER ON NORTH LINE SECTION 34, FOUND MONUMENT
- 1991 JAMES A. RAY PS#25869 SURVEY IN SECTION 34, LIBER 68, PAGE 330, MEANDER CORNER ON NORTH LINE SECTION 34 EAST SIDE STONE LEDGE LAKE, FOUND MONUMENT

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- 10 FOUND CONCRETE MONUMENT 27' EAST OF WATERS EDGE EAST SIDE STONE LEDGE LAKE. THIS CORNER IS A CAREFUL AND FAITHFUL RE-ESTABLISHMENT OF THE POSITION OF THE ORIGINAL MEANDER CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 10 MEANDER CORNER ON EAST SIDE STONE LEDGE LAKE ON SECTION LINE COMMON TO SECTIONS 27 & 34, T21N, R9W
CONCRETE MONUMENT WITH BRASS CAP STAMPED: CJP, 1999, M.C., 27, 34
N01°W 7" ELM 28.13'
N54°E 12" OAK 21.38'
N72°E 5" OAK 10.82'
S54°E 70" MAPLE 32.86'

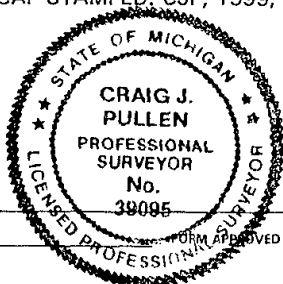

Peer Group Reviewed and Approved

Date: 12 Nov 99
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

igned by Craig J. Pullen

Date November 8, 1999

urveyor's Michigan License No. 39095

FILED 05 PAGE 191

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995