

00 AUG 14 AM 11:00

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
ROXAND TWP.

For corners in

Form with fields for Eaton (County), Located In, Corner Code #, and numbered sections 1-5 for Public Land Survey, Property Controlling in Section, Miscellaneous Property in Sec., Lot No., and Private Claims.

LINDA M. TWITCHELL
REGISTER OF DEEDS
EATON COUNTY, MICH.

LIBER 4 PAGE 135

Register of Deeds Stamp & File Number

I, RON HELSEL, in a field survey on JUNE 22, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration: ORIGINAL MONUMENT: POST SET BY ORANGE RISDON, U.S. DEPUTY SURVEYOR, MAR., 1827. SET POST AT 40 CHAINS. SUGAR 12", S32°E, 39 LINKS; LYNN 15", N32°W, 21 LINKS.

- 1) VOL. 1, PAGE 39, CO. SURVEYOR W.D. SOUTHWORTH IDENTIFIES THIS AS A STAKE WITH NO DIMENSIONS.
2) EATON CO. ROAD GRID MAP CALLS FOR A 1-1/2" PIPE WITNESSED AS: 21" MAPLE, EAST 22.80 FEET; 12" WALNUT, NE, 39.57 FEET; COR. FEN POST, WEST, 30.35 FEET (DID NOT FIND ANY EVIDENCE OF A PIPE OR THE BEARING TREES.)
3) AN UPDATED COUNTY ROAD MAP DATED 1929 BY H. WILLIAMS THEN CO. SURVEYOR SHOWS CUTLER ROAD AS EXISTING BETWEEN STRANGE HWY. AND NEEDMORE HWY. THIS ROAD IS NOW ABANDONED EXCEPT FOR 1400 FEET SOUTH OF STRANGE HWY. (THIS EXPLAINS WHY EATON CO. ROAD COMM. HAD OFF ROAD WITNESSES IN 2-A ABOVE)


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: SEARCHED THE AREA THOROUGHLY LOOKING FOR THE PIPE AND EVIDENCE OF A NORTH-SOUTH FENCE LINE AT THE OLD 3 ROD RIGHT OF WAY. FOUND EXISTING FENCE LINES EAST AND WEST. DEEMED THE CORNER OBLITERATED AND SET A 3/4" BY 24" FORM PIN AND EATON COUNTY STANDARD DISK ON LINE BETWEEN C-11 AND C-13 WHERE IT INTERSECTED THE EAST-WEST FENCE LINES. CORNER FIT WELL WITH THE SECTIONAL SPLITS NORTH, SOUTH AND EAST. I BELIEVE THIS POSITION IS A GOOD LOCATION FOR THE FAITHFUL PERPETUATION OF THE CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: STANDARD FORM PIN AND EATON CO. DISK STAMPED P.A. 345, P.S. NO. 18994 SET NAIL & TAG NO. 18994 NORTH/SIDE RAILROAD TIE POST, WEST, 7.01 FEET SET NAIL & TAG NO. 18994 EAST/SIDE TRIPLE 12" ELM, NORTH AZ. 210°, 46.12 FEET SET NAIL & TAG NO. 18994 EAST/SIDE 12" BASSWOOD CLUMP, NORTH AZ. 192°, 135.60 FEET SET NAIL & TAG NO. 18994 SOUTH/SIDE 12" BASSWOOD CLUMP, NORTH AZ., 18.89 FEET MEASURED SOUTH, 2642.64 FEET TO C-13 MEASURED NORTH, 2639.59 FEET TO C-11 MEASURED EAST, 2641.63 FEET TO D-12

SURVEY & MONUMENTATION

JAN 11 2001

SECTION

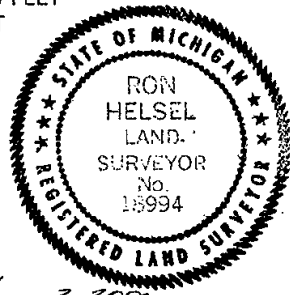

Signed by Ron Helsel
Surveyor's Michigan License No. 18994

Date Aug 2, 2000

P.A. 345 EATON COUNTY
PEER APPROVED 8/1/2000 RL