


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Missaukee (County)	Located In	Corner Code #
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>20</u> T <u>23N</u> R <u>7W</u>	<u>10</u>
	S <u>20</u> T <u>23N</u> R <u>7W</u>	<u>12</u>
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No: _____	Recorded Plat: _____	
5. Private Claims: _____		

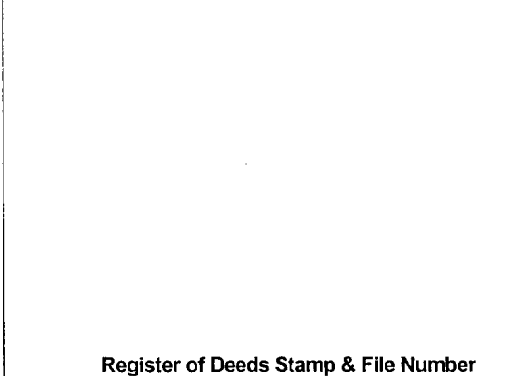

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4		3		2		1	
3													
4	7		8		9		10		11		12		
5													
6	18			17		16		15		14		13	
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Craig W. McVean, in a field survey on April 24, 2007 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- | | |
|--|---|
| <p><u>10</u> – 1892 & 1914 – CSR – FB. #35, p. 55 E - A. Beuthien –
Petition Survey Sec. 19
1) WPS 22 S6°E 20</p> | <p><u>12</u> – 1890 – CSR – FB #14, p. 66 – Oak Stake;
1) WPS 14 N51°E 35; 2) WPS 18° S31°W 18</p> |
|--|---|

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- | | |
|---|---|
| <p><u>10</u> – S 1/16 Cor. common to Sec. 19 & 20 - Set stamped 2" Alum. Cap on 5/8" x 34" rebar at record bearing and distance from Witness #1. Corner falls on E. side of rotted off 0.8' dia. Cedar king post for E-W Barb & wolvern wire fence remains. 2" Alum. Cap accepted as the best available evidence of the position of the corner.</p> | <p><u>12</u> – CS 1/16 Cor. Sec. 20 – Fd. 2" dia. x 3.1' long pine stake – Down 1' – in agreement with both 1890 BT's. #1 has good notch. Old down fence corner W & S is S33°E 20'±. Set stamped 2" Alum. Cap on 5/8" x 34" rebar on north side of pine stake. 2" Alum. Cap and pine stake accepted as the best available evidence of the position of the corner.</p> |
|---|---|

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|---|--|
| <p><u>10</u> – Stamped 2" Alum. Cap on 5/8" x 34" rebar.
Set Blue Carsonite Post with loc. tag 1' North.
S6°E 14.15' to 60d nail in centerline remains 22" WPS (#1).
S85°W 3.13' to chiseled '+' on top of 1.0' x 0.5' x 0.3' up white quartzite stone
N9°W 21.95' to set nail & tag in E. side 4" Oak
N69°E 24.37' to set nail & tag in NW side 4" Oak
S31°W 18.29' to set nail & tag in W side 14" S. Maple Clp. -5</p> | <p><u>12</u> – Stamped 2" Alum. Cap on 5/8" x 34" rebar.
Set Blue Carsonite Post with loc. tag 1' NW
N48°E 22.9' to Fd. notch on 14" WPS (#1)
S33°W 12.7' to set spike in centerline remains 18" WPS (#2)
S66°E 23.92' to set nail & tag in SW side 10" W. Pine
S82°W 21.69' to set nail & tag in S side 6" W. Pine
N44°W 44.87' to set nail & tag in NE side 7" W. Pine
N49°E 13.66' to set nail & tag in NW side 10" Oak</p> |
|---|--|

Signed by: Craig W. McVean
Surveyor's Michigan License No.: 39088

Date: 6/1/2010

