

JAN 18 2001

For corners in SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

Approved by Alger County  
Land Survey Remuneration  
Peer Group Under Act 245 of  
P.A. of 1990 On 12-13-2000  
*John O. Carlson*  
Chairman

05-218

Alger  
(County)

Located In:

Corner Code #

1. Public Land Survey T 48N R 15W M07 ✓  
T 48N R 14W A07  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

FILED  
TIME 8:50 AM

DEC 20 2000

DONALD W. KINNUNEN  
REGISTER OF DEEDS  
ALGER COUNTY, MI

Register of Deeds Stamp & File Number

I, Robert L. Jamros, in a field survey on October 25, 2000  
do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned  
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current  
manual of survey instructions of the United States Department of the Interior, Bureau of Land  
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and  
5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a  
Decree of a Court of Law; established, re-established, monumented, \_\_\_\_\_ recovered, found  
as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded  
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

**M07:** PLS William A. Burt, DS, 1841. Corner of Section 13 and 24 in pond. Tamarack 8", 1.56 chains North. W. Pine 18", 12.02 chains, South, of section corner in lake. These trees are notched for station trees. \*\*\*\*\* C.C.I. Co. T.J. McLaren, cruiser, 1966. Set meander post on East side of lake in boggy marsh 31 links East of corner. W. Pine 5", line tree, 99 links East of meander post in edge of timber. NBT's from this line tree. W. Pine 12", N.64°E., 19 links. W. Pine 6", S.52°E., 25 links. Unrecorded report. \*\*\*\*\* No other subsequent restoration of record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

**M07:** North of small lake found Tamarack stub down with blaze face showing scribing "Cor. 1.56 S.". W. Pine 18", station tree 12.02 chains South, not found. Found W. Pine 5" line tree 1.30 chains East of corner and NBT's of same, meander post not found. Established corner position by single proportionate measurement between stump of Tamarack station tree (1.56 chains North) and section corner 1 mile South. Monumented decayed stump of station tree and established witness corner 50 feet East of corner position and 35.8 feet West of W. Pine 5" line tree (1966 report). Corner position is accepted as a careful and faithful perpetuation of the position of the original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

**M07:** Set 2½" x 30" Berntsen aluminum monuments no. A1NB30 with ¾" aluminum caps stamped to identify relationship to section corner position. Established reference trees with BT signs, blazed, scribed and painted. Set PK nails for measure with aluminum I.D. washers in the following: **STATION TREE**, cap stamped "Cor. 103.2 Ft. S"; Hemlock 7", N.51°W., 9.97 feet (WC BT); Hemlock 5", N.74°E., 11.13 feet (WC BT); Hemlock 8", S.02°E., 5.80 feet (WC BT); Hemlock 5", S.43°W., 8.52 feet (WC BT). Survey marker sign on 6 foot steel post, S.36°E., 1.0 feet. **WITNESS CORNER**, cap stamped "Cor. 50 Ft. W."; Spruce 8", N.26°W., 29.41 feet (WC BT); Spruce 10", N.32°E., 30.30 feet (WC BT); W. Pine 24", N.72°E., 37.76 feet (WC BT); Spruce 10", S.16°E., 29.47 feet (WC BT). Survey marker sign on 6 foot steel post, S.45°, 0.80 feet. All bearings are magnetic. \*\*\*\*\* See sketch on back.

Signed by Robert L. Jamros

Date Dec 17, 2000

Surveyor's Michigan License No. 25849

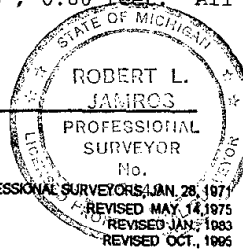

T48N, R15W M-7

