

MAR 16 1994

ALLEGAN COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
ALLEGAN COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 2N R 12W

G-7 (SE, 16)

T R

WATSON TWP.

T R

T R

2. Property Controlling

S T R

in Section

S T R

3. Miscellaneous

S T R

Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

Register of Deeds Stamp & File Number

I, BASIL ANDRESS, in a field survey on DECEMBER 27, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. - NORTH BETWEEN SECTIONS 21 & 22, 80.00 CHS. SET POST COR. SECTIONS 15, 16, 21 & 22.

WITNESSES: BEECH 18 S 80 E 33 Lks. (21.78')

BEECH 15 N 83 W 27 Lks. (17.82')

COUNTY SURVEYOR'S OLD NOTES: STONE

WITNESSES: ELM 14 NE 65'  
ELM 12 NW 90.5'

IRON

WITNESSES: TWIN ELM NE 63.2'  
FENCE POST NORTH 18.8'  
TP NE 24.0'

(CONT. ON BACK OF CERTIFICATE)  
B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FD. CAPPED IRON PER OLD SURVEYS AND WITNESSES.

REPLACED CAPPED IRON WITH STD. ALLEGAN CO. MON.

THIS CORNER IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

APPROVED BY THE ALLEGAN COUNTY REMONUMENTATION PEER GROUP 12-21-93.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


REPLACED CAPPED IRON W/ STD. ALLEGAN CO. MON. (3/4" STEEL PIN W/ REMON. CAP)

NAIL & REMON. WASHER S SDE 8" PINE WNW 99.99'  
NAIL & REMON. WASHER SW SDE 6" PINE NW 107.87'  
NAIL & REMON. WASHER W SDE 12" ASH SOUTH 39.16'  
NAIL & REMON. WASHER NE SDE 9" ELM SE 96.24'  
NAIL & REMON. WASHER NW SDE 11" ASH NE 72.42'

Signed by Basil J. Andress, Jr.

Date 12-21-93

Surveyor's Michigan License No. 30075

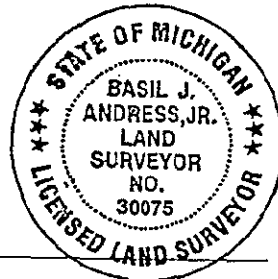

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971;  
REVISED MAY 14, 1975  
REVISED JAN., 1983

LIBER 004 PAGE 359

SHEET 1 OF 2

(CONTINUED FROM FRONT OF CERTIFICATE)

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/ OR SUBSEQUENT RESTORATION.

COUNTY SURVEYOR'S OLD NOTES: MEAS. EAST 1329.25' TO 1/8 POST CONT. EAST  
1329.25' TO SEC COR.

1965-D. A. RATEKIN, C.S. MEAS. EAST 2656.03' TO 1/4 COR.

1971-D. A. RATEKIN, C.S. MEAS. WEST 2665.16' TO 1/4 COR.  
MEAS. SOUTH 2652.78' TO 1/4 COR.

1972-D. A. RATEKIN, C.S. L.C.R.C. (L-1, P-23)

1993-K. VAN ORDER, C.S. MEAS. EAST 2653.63' TO 1/4 COR.  
MEAS. SOUTH 2652.57' TO 1/4 COR.