

SURVEY & REMONUMENTATION

APR 27 1995

CHIPPEWA COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

For corners in

Chippewa  
(County)

Located In:

Corner Code #

1. Public Land Survey

T 46N R 1E

K-2

2. Property Controlling  
in Section

S T R

3. Miscellaneous  
Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

\$ 7.00 LAND CORNER

\$ 2.00 MSSR

5 DEC 94 12:10 P.M. RECEIPT# 1517

RECEIVED FOR RECORD

CHIPPEWA COUNTY - STATE OF MICHIGAN

SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, William L. Karr, in a field survey on October 19, 1994

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(K-2) 1/4 Corner Sections 2 & 1, T.46 N., R.1 E.

1845: J. Mullett set 1/4 section post Elm 8 S64W 19 Birch 14 N25E 23

1946-1949: Corner was called for in (3) recorded plats in the area.

1989: L.R. Rogers re-established corner position from the "David Eagle Plat of Hay Lake" (L.6 of plats, P.9) and set a 1/2"x 24" iron w/cap No. 29251.

|                                  |      |        |
|----------------------------------|------|--------|
| Witnesses: Poured conc. monument | N40E | 45.76' |
| 12" Yellow Birch                 | S60E | 80.77' |
| 10" Maple                        | S32W | 87.05' |
| 14"Ash                           | N30W | 75.51' |

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K-2) This corner is being perpetuated as part of the Chippewa County Remonumentation program.


Found no evidence of original corner. Found the 1/2" iron w/cap No. 29251 and all witnesses. Accepted corner position as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K-2) Corner is a 1/2" iron w/cap No. 29251 set flush with the surface of Scenic Drive(paved) and approximately 10' South of the centerline of E-W drainage ditch.

|                     |       |                |
|---------------------|-------|----------------|
| Witnesses: 16" Ash  | N30°W | 75.51'         |
| 1" iron in concrete | N40°E | 45.76'         |
| 10" Yellow Birch    | S44°E | 75.40'         |
| 12" Maple           | S32°W | 87.05'         |
| 12" Yellow Birch    | S60 E | 80.77' (Dying) |

Note: Trees are not blazed.

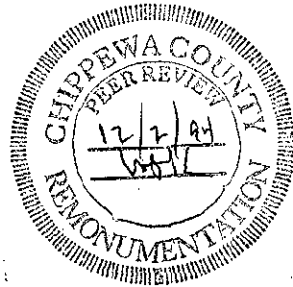

Signed by

William L. Karr

Date

12/2/94

Surveyor's Michigan License No. 27450

NOTE: Bearings are compass bearings corrected for declination.

Distances are to a nail in side of witness objects unless noted.