LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Chippewa County Remonumentation Corner \$7.00 LAND CORNER

For corners in

Chippewa County Located in: Corner Code # M-7/ M-8 Same A-7/ A-8 Corner 1. Public Land Survey **T46N R1E** T46N R2E R T R 2. Property Controlling S T R in Section S T R 3. Miscellaneous S R Property in Sec. S R SURVEY & REMONUME?

\$2.00 HSSR 2/28/1997 2:53:31 PM Rec RECEIVED FOR RECORD CHIFFENA COUNTY + STATE OF SHARON H. KEUNEDY, REGISTE!

BOOK 9 PAGE 354

Register of Deeds Stamp & File Num

4. Lot No.

. Recorded Plat

5. Private Claims


JUL 2 2 14

SECTION

I, William L. Karr, in a field survey on November 13, 1996, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

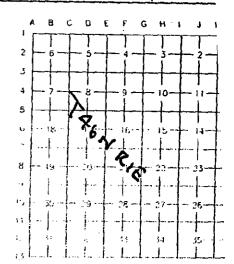

(M-7 / M-8) Meander Corner Common to Section 24, T. 46 N., R. 1 E., and Section 19, T. 46 N., R. 2 E.

1845 J.H. Mullett set post in original survey, 10 chains North of the 1/4 corner.

Witnesses:

Willow 7"

S 47° W

1.63 ch

Willow 8"

S 86° W

3.19 ch

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

2 Emminus annum (M-7 / M-8) Meander Corner Common to Section 24, T. 46 N., R. 1 E., and Section 19, T. 46 N., R. This corner is being reestablished as part of the Chippewa County Remonumentation Program.

Could find no evidence of the original corner or subsequent restoration.

Reestablished the corner on the extension of the section line to the South at the record GLO distance North from the 1/4 corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(M-7 / M-8) Meander Corner Common to Section 24, T. 46 N., R. 1 E., and Section 19, T. 46 N., R. 2 E.

Corner is a 3/4" x 48" re-rod with stamped aluminum Chippewa County Remonumentation Cap. Corner is set in open marshy area and is 1' above ground.

Witnesses:

North 120 Waters Edge Waters Edge East 90 Wood Post North 3.00' S 01° 11' 01" E 660.00 1/4 Corner S 01º 11' 01" E 3300.001 Section Corner N 36° 58' 23" W 2433.81 Meander Corner on

ILLIAM I KARR LAND SURVEYOR

E OVUMEN

Bearings are grid bearings based on the Michigan State Plane Coordinate System, North Zone. Distances a distances to adjacent corners. No other acceptable ties available.

North Section Line

Date 12-30-46

Surveyor's Michigan License No. 27450

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED LAN., 1983
REVISED LAN., 1983

other code: 5