JAN 2 7 2000

SECTION

For corners in

LAND CORNER RECORDATION CERTIFICATE **CLINTON COUNTY REMONUMENTATION** WEST 1/4 CORNER, SECTION 6, T5N-R2W **DEWITT TOWNSHIP**

Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 004 PAGE 341

Clinton (County)		Located in:	Corner Code #	1
Public Land Survey		T_5N_R_2W_ TR TR	A-2	DEC
Property Controlling In Section	s s	TR TR T R		cili Æ
3. Miscellaneous	s.	T R		
Property in Sec.	s			
4. Lot No		, Recorded Plat		
5. Private Claims				

2 | 12 48 PM '99 GIS THE LITTEDS NTON COURTY, MICH. യ∠Registeres Deeds Stamp & File Number

SECORDED


I, Mark L. VanRaemdonck, in a field survey on, June 10, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration;
 - 1. Original, not a G.L.O. corner. No record was found of the original corner position.

2. Larry A. Bryan, L.C.R.C., recorded Liber 2, page 553, March 18, 1995. Monument: Found 1/2" bar 3.5' West of centerline Airport Road on fence line East. Accessories: Set Nail & Tag North side corner post S80°W 33.75' Set Nail & Tag South side power pole East 48.23' Set Nail & Cap West side 16" Ash S35°W 150.80' 1/2" bar & cap East 1/4 corner, Section 1, T5N-R3W South 12.10"

3. Larry A. Bryan, Certified Survey, recorded Liber 3, page 536, February 2, 1990. Monument: Found ½" bar 3.7" West of centerline Airport Road on fence line East. Accessories: Found Nail & Tag #25832 South side power pole East 48.30 Found Nail & Tag #25832 South side North side fence post S80°W 33.77' Set Nail & Tag SW side 8" Pine N45°E 60.72'
½" bar East 1/4 corner, Section 1, T5N-R3W S13°E 12.03'

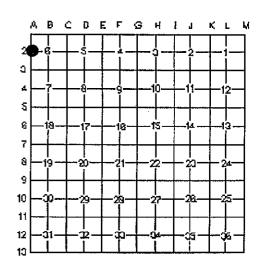

APPROVED BY CLINTON COUNTY PEER GROUP DATED _

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

l established this corner position on the line between corners M-2, T5N-R3W, and M-1, T5N-R3W at proportion distances to G.L.O. distances between corners A-1, T5N-R2W and A-3, T5N-R2W. A-1 to A-2, G.L.O. = 39.37 chains (2598.42 feet) measured 2596.12 feet. A-3 to A-2, G.L.O. = 40 chains (2640.00 feet) measured 2637.74 feet. This location is 2.73 feet East of the 1/2" bar referenced in No. 2 and No. 3 above. Found no other conflicting evidence. I accepted this location as the careful and faithful establishment of the original corner position.

C. Description of monument for corner and accessories to perpetuate locating the position of the corner:

Set a standard Clinton County Remonumentation monument, being a 2 1/2" diameter steel tube, 30" long with a standard brass cap, stamped "P.S. 24622", and a breakaway magnetic base at the corner location described in Section B above. The monument is witnessed by the following accessories:

East 45.30' Set N&T N. face util. Pole S50°E 58.61' Fnd. N&T SW face 12" Pine S40°W 57.70' Fnd. N&T SE face 8" Black Ash S75°W 43.52' Set N&T S. face 8" Oak N00°16'43"E 2596.18' Remon Monument at A-1 S00°16'43"W 11.63' Remon Monument at M-2

Bearings to A-1 and M-2 are based on solar observations.

Signed by Muck L. Vandan L.

Surveyor's Michigan License No. 24622

Date 12-16-99

OF MICHIGAN MARK I
VANRAENDONCK
PROFESSIONAL
SURVEYOR
No.
24622
JAN 18, 1971
REVISED MAY 1
1980 JAN
1980 JAN

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN 18, 1971

REVISED MAY 14, 1975 REVISED JAN., 1983