

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(DICKINSON COUNTY)

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 40 N. 30 E. R. 30 W.	#I-5
2. PROPERTY CONTROL- 10 ING IN SECTION	T. 40 N. 30 E. R. 30 W.	#14
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on July 11, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner I-5 (Section Corner 10,11, 14, & 15, T40N, R30W):

Wood post (Not found. Found old rock mound in place.)
Birch 10 S22E 24 (Not found. No subsequent accessories found.)
Birch 8 S13W 13 (Not found. No subsequent accessories found.)

Corner 14 (South 1/16 corner between Sections 10 & 11, T40N, R30W):

Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner I-5: Placed a monument described below at a very old rock mound believed to have been erected at the corner in the pioneer farm days of the local area, presumably by someone who may have known where the original corner was. Position checks within 5 lks. of a stream crossing to S and agrees with calls to summit of hill 3 ch. S and to descend from post in the sec. line bet. Sec. 10 & 11. Found a crude fence corner (more recent than the rock mound) N10°13.1'E 103.1 ft., with rough fence lines running S and W, but at questionable bearings; the fence corner does not conform at all well with the original field notes.

Corner 14: Established on line between Sec. Cor. 20.2225 ch. S and 1/4 cor. 20.2225 ch. N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner I-5: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap, set in a rock mound.

White Pine 6 N49°E (mag.) 50.3 ft. "S11, NBT"

Red Maple 6 N20°W (mag.) 33.3 ft. "S10, NBT"

6" x 6" x 5' squared & scribed cedar post N20°W (mag.) 3.5 ft.

Declination 5°40' West.

Corner 14: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.

R. Pine 7 S57°E (mag.) 18.5 ft. "1/16S, BT"

R. Pine 7 N68°E (mag.) 25.5 ft. "1/16S, BT"

W. Pine 5 S35°W (mag.) 18.4 ft. "1/16S, BT"

Declination 3° 30' West.

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____


APPROVED AND SIGNED BY Arthur O. Enger DATE March 2, 1980

MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger

Michigan Department of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581

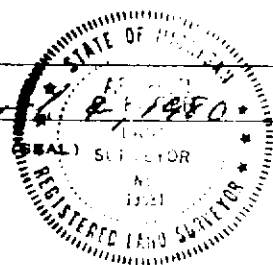

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET