

E-1/E-13 T42N, R29W

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1999 NOV 30 PM 3:31

For corners in

DICKINSON

(County)

NORWAY TOWNSHIP

Located In:

Corner Code #

1. Public Land Survey

T 41 N R 29 W

E-1

T 41 N R 29 W

E-3

T R

T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous  
Property in Sec.

S

T R

S

T R

SURVEY &  
REMONUMENTATION

REGISTER OF DEEDS  
DICKINSON COUNTY  
RON MOORE, CLERK

Register of Deeds Stamp & File  
Number

4. Lot No. , Recorded Plat MAR 24 2000

5. Private Claims SECTION

I, JAMES H. MOORE, in a field survey on AUGUST 19, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4		3		2		1	
3													
4	7			8		9		10		11		12	
5													
6	18			17		16		15		14		13	
7													
8	19			20		21		22		23		24	
9													
10	30			29		28		27		26		25	
11													
12	31			32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

E-1 CORNER COMMON TO SECTIONS 4-5 (T41N, R29W)  
AND SECTIONS 32-33 (T42N, R29W)  
CEDAR POST BY AUSTIN BURT, D.S. 1847  
SPRUCE 9" N 28° E 28 LINKS  
CEDAR 12" N 38° W 46 LINKS

E-3 CORNER COMMON TO SECTIONS 4-5-8-9  
CEDAR POST BY JOHN BURT, D.S. 1849  
WHITE BIRCH 16" S 37° W 28 LINKS  
CEDAR 14" N 38° E 30 LINKS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-1 FOUND 1" PIPE WITH A 4" BRASS CAP, SET BY  
DEAN DE LA MATER R.L.S. #13030.

E-3 FOUND 3" BRASS CAP IN 6" DIAMETER CONCRETE MONUMENT,  
SET BY EDWARD KAZIANKA P.S. 14765.  
FOUND TWO EXISTING BEARING TREES

1951 BEARING TREES

10" CEDAR S 83° E 15 LINKS  
10" CEDAR S 18° E 31 LINKS

1966 BEARING TREES

12" WHITE PINE N 56° E 37 1/2 LINKS  
6" MAPLE N 28° W 19 LINKS  
9" MAPLE S 25° W 27 1/2 LINKS

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-1 FOUND ABOVE DESCRIBED MONUMENT IN PLACE  
NEW WITNESSES

8" CEDAR S 67° E (M.B.) 75.10' NAIL/TAG  
10" CEDAR N 77° E (M.B.) 69.84' NAIL/TAG  
11" CEDAR S 85° W (M.B.) 74.42' NAIL/TAG  
8" CEDAR N 44° W (M.B.) 93.68' NAIL/TAG  
CARSONITE MARKER NORTH 0.85'

E-3 FOUND ABOVE DESCRIBED MONUMENT IN PLACE  
NEW WITNESSES

12" WHITE BIRCH S 68° E (M.B.) 26.80' NAIL/TAG  
8" MAPLE N 75° E (M.B.) 19.52' NAIL/TAG  
9" MAPLE S 29° E (M.B.) 41.08' NAIL/TAG  
9" MAPLE S 80° W (M.B.) 17.23' NAIL/TAG  
CARSONITE MARKER WEST 1.00'


Signed by

Surveyor's Michigan License No.

JAMES H. MOORE

28423

Date 11-8-99

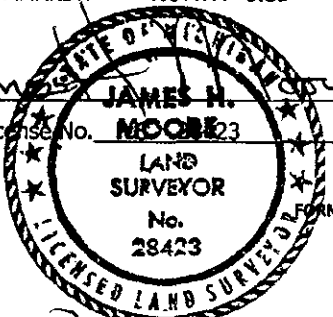

FORM APPROVED BY: MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
CORNER UNDER MICHIGAN PUBLIC ACT  
345 OF 1990 AT A MEETING HELD ON  
11-23-99

REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995

Lib 3 PAGE 4