

SURVEY & MONUMENTATION

JAN 11 2001

FILED

Copy

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

EATON COUNTY

(County)

ROXAND TOWNSHIP

1. Public Land Survey

Located in:

Corner Code #

T 4N R 5W

L-10

T R

T R

T R

T R

2. Property Controlling in Section

S

T R

3. Miscellaneous

S

T R

Property in Sec.

S

T R

LINDA M. TWITCHELL
REGISTER OF DEEDS
EATON COUNTY, MICH.

LIBER

4 PAGE 159

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on JULY 24, 2000

do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. CORNER NOT SET IN ORIGINAL GOVERNMENT SURVEY

2. M.H. BAILEY, COUNTY SURVEYOR, RECORDED CORNER IN A SURVEY RECORDED IN VOLUME 2 PAGE 129 COUNTY SURVEYORS RECORDS IN APRIL 1880 AS A STAKE.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED AT APPARENT LOCATION OF CORNER AND FOUND LARGE FENCE POST AT NORTH END OF FENCE FROM SOUTH. EXCAVATED 3" DIAMETER HOLE AROUND FENCE POST AND FOUND MANY STONES AND BROKEN TILE. ACCEPTED POST AS CORNER AND DROVE 3/4" BAR X 24" STEEL BAR WITH 2 1/2" ALUMINUM CAP IN ON NORTH SIDE OF IT. CORNER IS 5.75' WEST & 0.9' NORTH OF INTERSECTION OF 1/4 LINES.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-10 T4N, R5W

3/4" X 24" STEEL BAR & 2 1/2" ALUMINUM CAP IMPRINTED PA 345 25837 EATON COUNTY AT NORTH END FENCE LINE

SET NAIL & TAG #25837 IN WEST SIDE 18" OAK, S8°W, 37.70' (NO OTHER GOOD NATURAL WITNESSES)

L-9, T4N, R5W, N00°09'50"W, 2640.93'

M-10, T4N, R5W, N89°54'10"E, 2650.00'


L-11, T4N, R5W, S00°05'08"E, 2644.58'

K-10, T4N, R5W, S89°56'23"W, 2640.97'

Signed by David Clifford

Date JULY 29, 2000

Surveyor's Michigan License No. 25837

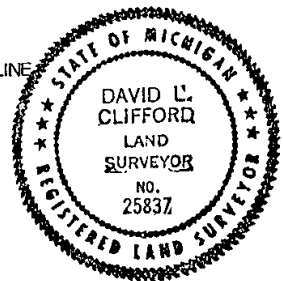

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1976
REVISED JAN. 1983
REVISED OCT. 1996

P.A. 345 EATON COUNTY
PEER APPROVED 8/01/2000 rc