REMONUMENTATION

NOV 1 2 1997

Private Claims _____

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Register'	s Office]
Register' Cogebic	County	85.


Received for record the
day of October
A. D. 19 97 at 10:50 o'clock
m., and recorded in
Liber 6 OF CORNERS
page 222
Ramona Calling Deputy Register of Deuts
Register of Deuds

For corners in	Filing Requirement of Act 74, Mich. P.A. 1970		q Is day of October
-Gogebic	Located In:	Corner Code ##	A. D. 19 97 at 10:50 e'clock m., and recorded in
1. Public Land Survey	T <u>45N</u> R <u>46W</u> T R T R T R	610	page 222 Ramiona Colling Deputy
2. Property Controlling in Section	S T R S T R		Register of Deuds
3. Miscellaneous Property in Sec.	S T R S T R		Register of Deeds Stamp & File Number
4 Lot No	Recorded Plat		

Mile Corner no 2, Mich. --- Wisc. State Line

I, Richard I. Drahnin a field survey on September 25, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

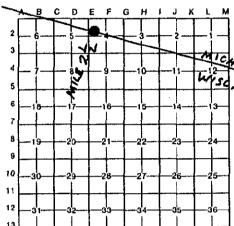

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by William Burt in 1847. Original B.T.s --- Y. Birch 16" S.62 E. 21 links (13.86') --- Maple 10" N.23 W. 6 links (3.96') ---

Corner restored in 1928 by Earl G. Harrington from the remains of the two original B.T.s. He set a standard brass capped concrete monument and two new B.T.s:--Hemlock 14" S.00-30 W. 41.6' --- Y. Birch 10" N.06-15E. 14.2'

Daniel K. Pleoger (Wisc. No. S-1537) recovered the concrete monument on 5/2/85 and established the following new B.T.s: --- 9" (11") Red Maple

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

N.40 W. (N.40 W.) 3.62' (3.46') --- 8" (11") Yellow Birch N.51 E.(N.53 E.) 36.47' (36.47') --- 6" (9") Sugar Maple S.67 E. (S.66 E.) 37.63' (37.60') --- 10" (13") Hemlock S.01E. (S.02 E.) 30.88' (30.67') ---

I recovered the concrete monument as described in Harringtons notes and the 1985 B.T.s as described in parentheses above. No evidence remains of the 1847 Y. Birch B.T.. A very large, badly decayed Red Maple stump still remains at N.23 W. 4.0'.

Research form on file with Gogebic County records.

A stump hole with Yellow Birch wood and bark are all that remains from the 1928 B.T.s.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

From the above described concrete monument I established the following new bearing object:

61 Steel sign rail S.01 E. 2.76'

COUNTY

CE OF MICH **RICHARD** L. DRAHN LAND SURVEYOR No. 21564

Signed by	Richard	L. Wi	alm

Date <u>September 29, 1997</u>

Surveyor's Michigan License No. 21564