## SUFFVEY & REMONUMENTATIO

NOV 1 2 1997

For corners in

5. Private Claims \_

COMMISSION

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Register's Office ss. Gogebic County

	Rece	ived	for	record	the
9	·T4	_day	of_	OCTOB	LR
A. D.				50 0'c	
				recorded	
Liber	6		_of	CORNI	£ 25
Ran	nona	Col	w	D. Dy	outh

Register of Deeds

Gogebic (County) Corner Code ## Located In: FG 2-3T 45N R 46W 016 \_\_\_ R \_ 009 R

Register of Deeds Stamp & File Number


1. Public Land Survey \_ R . **Property Controlling** S S \_\_\_ T \_\_\_\_ R \_ in Section \_ T \_\_ Miscellaneous S Property in Sec.

Mile Corner No. 3, Mich. --- Wisc. State Line

\_ , Recorded Plat \_

i, Richard L. Drahnin a field survey on September 25, 19 97 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

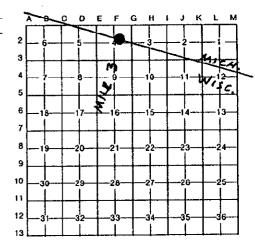

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by William Burt in 1847. Original B.T.s --- Cedar 9" S.30 W. 5 links (3.30') --- Y. Birch 8" N.52 E. 13 links (8.58') ---

Corner restored in 1928 from the two scribed original B.T.s by Earl G. Harrington. He set a standard brass capped concrete monument and no new B.T.s.

Daniel K. Pleoger (Wisc. No. S-1537) recovered the concrete monument and the two original B.T.s, one still alive. He set three new B.T.s: --15" (15") Cedar N.67 W. (N.67 W.) 20.34' (20.19') --- 8" (9") Cedar N.64 E.
Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(N.65 E.) 36.04' (36.35') --- 12" (12") Cedar S.47 W. (S.47 W.) 30.21'

I recovered the concrete monument as described in Harringtons notes and the 1985 B.T.s as described in parentheses above. The 1847 Cedar B.T. is now a 12-14" decayed Cedar windfall with GLO blazes. The original Y. Birch B.T. is now a 22" live Yellow Birch with GLO blaze bearing N.52 E. 9.08' to a nail in the side of the B.T.

Research form on file with Gogebic County records.

A 11" scribed ( 3 M ) Cedar stub bears S.75 W. 7,9', source unknown.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

From the above descrived monument I established the following:

N.19 E. 3.201 61 Steel sign rail

OF MICHIE RICHARD L. DRAHN LAND SURVEYOR No. 21564

Date September 29, 1997

Surveyor's Michigan License No. 21564 USFS CD 11-12

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971