

2000 REMONUMENTATION

Re-New Liber 2, Page 94

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in

Huron
 (County)

Located in:

Corner Code #

 STATE OF MICHIGAN
 HURON COUNTY
 RECORDED

29 NOV 2000 11:22 AM

 FRANCES L. HOLDNICK
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

1. Public Land survey: Brookfield T 15_N R 10_E

A-3 ✓

T R

A-4

T R

T R

T R

 SURVEY &
 MONUMENTATION

JAN 19 2001

2. Property Controlling in Section

S T R

S T R

3. Miscellaneous

S T R

Property in Sec.

S T R

4. Lot No. , Recorded Plat

SECTION

5. Private Claims

I, James T. Meek, in a field survey on October 1, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expessed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 Original survey, West Bdy. T15NR10E, 1835,
 Harvey Parke D.S.

A-3 Corner of Sections 6, 7

Post

Maple 7", S46°W, 33 links

Beech 12", N11°W, 43½ links

County Surveyor's Record: ¾" iron

Recorded Surveys: L4, P524; L4, P278; L3,

P166 (All Case)

LCRC: none

A-4 West ¼ Corner of Section 7

Post

B. Ash 14", S12½°W, 40 links

Maple 18", N32°W, 19 links

County Surveyor's Record: ¾" iron

Recorded Surveys: L4, P278; L3, P166; L4, P19;

L1, P493 (All Case)

LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-3 Corner of Sections 6, 7

Found 1" pipe in mon box

At intersection of Bay Port & Canboro Road

 Accepted as the best available evidence
 of the original corner position.

A-4 West ¼ Corner of Section 7

Found ¾" iron in mon box

1' East of centerline of Bay Port Road Drain bears West

 Accepted as the best available evidence
 of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-3 Corner of Sections 6, 7

1" pipe in mon box

From which:

Road sign post bears N50°E, 41.2'

Tag in power pole bears S50°E, 86.3'

Concrete ROW marker bears S40°W, 46.6'

Road sign post bears S60°W, 41.9'

A-4, ¼ Corner of Section 7 bears

S0°09'42"E, 2634.54'

A-2, ¼ Corner of Section 6 bears

N0°09'19"W, 2643.58'

A-4 West ¼ Corner of Section 7

¾" iron in mon box

From which:

Tag in power pole bears N25°E, 106.1'

Wood post bears S85°E, 43.7'

¾" iron bears S45°W, 25.0'

Tag in power pole bears N 45°W, 45.7'

A-5, Corner of Sections 7, 18 bears

S0°09'20"E, 2634.63'

A-3, Corner of Sections 6, 7 bears


N0°09'42"W, 2634.54'

Signed by

Date

Surveyor's Michigan License No. 39089

APPROVED AT PEER BOARD MEETING 11-02-00 RRB

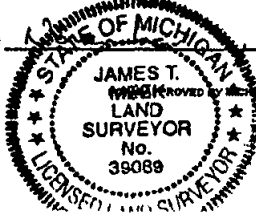

2000