HILLSDALE COUNTY REMONUMENTATION

LIBER 5 PAGE 39

AL COURSE

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

HILLEDACE CO MICH.
00 00T 11 7510: 42
REACT DITTE

For corners in

HILLSDALE	Located in:	Corner Code #
(County) ADAMS TWP.	•	
1. Public Land Survey	T <u>6S</u> R <u>2W</u> T R T R T R	<u>H-11</u>
2. Property Controlling in Section	S T R S T R	
3. Miscellaneous Property in Sec.	S T R S T R	

SURVEY & REMONUMENTATION

JAN 1 2 2001


SECTION

Register of Deeds Stamp & File Number

	Lot No.	,	Recorded	Plat	MATERIAL STATE And Administration of the state of the sta
-	Private Claims				

I, <u>Frederick J. Cutcher</u>, in a field survey on <u>Sept. 18 2000</u> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

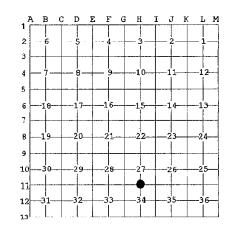

Description of original monument and accessories and/or subsequent restoration:

GLO, Robert Clark, Jr., Apr. 1825; Set Quarter Post; Sugar 30" N. 25° W. 15 lks,; W. Oak 24" S. 65° E. 17 lks.

Records of Ringenberg Engineering, Mar. 19, 1999: 5/8" rerod set 1/2 way on S. line Sec. 27; 1.2' S. of centerline on fenceline S.; Nail 27" Oak North 31.00; Nail R.R. tie fnc. Post South 27.25; Nail 12" Pine N. 45° E. 43.20; 18" Maple S. 50° E. 52.35'.

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 5/8" x 12" iron. All references from records of Ringenberg remain (18" Maple is 18" Locust). Dug at position of 5/8" iron. Nothing else found.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced 5/8" x 12" iron with 3/4" x 30" iron with remonumentation cap in monument box and is accepted as the best available evidence of the position of the original corner.

2' S. of centerline E/W road; in line with fence to South.

Found Nail 27" Oak North 30,93' Found Nail R.R. tie South 27.22' Found Nail 12" Pine N. 55° W. 43.20' Found Nail 18" Locust S. 60° E. 52.31'

Surveyor's Michigan License No.

Signed by

Date 24592

5

OF SHOWING

PROFESSIONÁLOS UNVEYORS, JAN. 28, 1971 CESSION REVISED MAY 14, 1975
REVISED JAN., 1983

FORM APPROVED BY MICHIGAN STATE BOARD