14900	SURVEY PER GROUP AS THE OFFICIAL SURVEY PER GROUP AS THE OFFICIAL CONNER UNDER MICHIGAN PUBLIC ACT 3/5 OF (1/98) A MEETING HELD ON A RINGENBERG, CO. EFF.	7
		- 1

## LIBER 5 PAGE 46

## HILLSDALE COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECORUSO	035914
HILLSDALE CO.	MICH.

00 NOV 13 AM 11: 09

17%		
2 2	·	13- 2
7	~\ <sub>~</sub>	Oan Janes
. / /	0	f: \
. 🔾	D WOOD II	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~
	REGI	REVERV &

EMONUMENTATION

SECTION

JAN 1 2 2001

		le Number

i or comers m		
HILLSDALE	Located in:	Corner Code #
(County) PITTSFORD TWP.		•
d Dublic Land Comer	T70 D4W	E 7
1. Public Land Survey	T <u>7S</u> R <u>1W</u>	<u>F-7</u>
	T R	<del> </del>
	T R	
	TR	
2. Property Controlling	S T R	
in Section	S T R	**************************************
	~	
3. Miscellaneous	S T R	
Property in Sec.	S T R	

I, Frederick J. Cutcher , in a field survey on Oct. 21 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in


, Recorded Plat

lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

4. Lot No. 5. Private Claims

NOTE:

Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

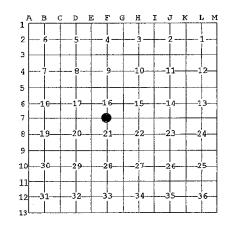

Description of original monument and accessories and/or subsequent restoration:

GLO, Robert Clark, Jr., 1824: Set Quarter Section Post at average distance; Beech 14" S. 11° W. 24 lks.; Beech 16" N. 36° E. 15 lks.

LCRC L. 2, P. 25, Jan. 15, 1981, Kenneth Suydam, P.S. #17636: Set P.K. in centerline M-34 and in line with fence South; Nail & shiner in R. R. tie post South 48.40'; Nail & shiner in elec. pole S. 60° E. 83.15'.

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found old P.K. in centerline M-34 in line with field line to North and South. All references are gone. Measured between corners to verify location of P.K.

M= 2632.81 M= 589-55-05E M= 2630.20 M= 589-59-18E

Description of monument for corner and accessories established to perpetuate locating the position of the corner;

Replaced P.K. with 3/4"x 30" iron with remonumentation cap in monument box and is accepted as the best available evidence of the position of the original corner.

in centerline M-34 and in line with field line to North and South

Set nail & spotter pwr. Pole North 58.76'

Set nail & spotter pwr. Pole S. 5° W. 250.0' Cen. of sign S. 7° E. 28.0'

Cen. 8" Maple N. 72° E. 173.50'

Journ St. Million WICHIGAN Me Date of the Date of the N

Cutcher

24592

11/9/2000

Surveyor's Michigan License No.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983