

\$7.00
\$2.00 SEP 18 1935

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
KENT COUNTY REMONUMENTATION

For corners in

Kent
(County)

Located in:

Corner Code #

- | | | |
|------------------------------------|------------|------|
| 1. Public Land Survey | T 5N R 12W | D-11 |
| | T R | |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S T R | |
| | S T R | |
| 3. Miscellaneous Property in Sec. | S T R | |
| | S T R | |

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Randy Kolehouse, in a field survey on April 11 19 95, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

D-11	1831	G.L.O. Notes	Mullett	Set Post	P.A. 345 1990 KENT COUNTY
	1961	Wit. Map	K.C. Surveyor	Monument	PEER APPROVED 6/27/95
	1972	L.C.R.C. #212	Exxel Engineering	Found 3/4" Iron	CHAIRMAN <u>Randy Kolehouse</u>
	1972	L.C.R.C. #320	Williams & Works	Found 1" Iron in Bit.	
	1981	L.C.R.C. #1633	Nederveld & Jonker	Found 3/4" Iron Over 2 Plow Points/Set K.C. Mon.	
	1988	L.C.R.C. #4658	J. Bueche	K.C. Monument	

This corner was originally approved by the Kent County Remonumentation Peer Group and monumented by Nederveld & Jonker on 3/6/81 and was recorded per L.C.R.C. #1633.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- D-11 Found standard Kent County Monument 1.0' South of C/L of 100th Street running E-W and 1.0' East of C/L of Homerich running N-S per L.C.R.C.'s #1633 and #4658 as set by Nederveld & Jonker in place of 3/4" iron over 2 plow points which checked L.C.R.C. #212.

L.C.R.C. #1633

Nail & Remon. tag on N side T. pole S80°W 123.80'
Nail & Remon. tag on SW side P. pole N60°W 174.75'
NE corner former school hse. fnd. S45°W 68.98'
Centerline "X" of B.T. is 1' N & 1' E

L.C.R.C. #4658


Nail & K.C. Remon tag on N sde T pole S 80 W 123.80'
New nail & K.C. Remon tag on SW sde T pole S 40 E 39.18'
Nail & K.C. Remon tag on SW sde P pole N 60 W 174.75'
NE cor former school hse fndn S 45 W 68.98'
C/L bit rd E & W is 1' N

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- D-11 Standard Kent County Monument

NE cor. school bldg. S 45° W 69.00'
Nail & K.C. remon. tag on N side T. pole S 80° W 123.80'
Nail & K.C. remon. tag on SW side T. pole S 40° E 39.18'
Nail & K.C. remon. tag on P. pole N 60° W 174.66'

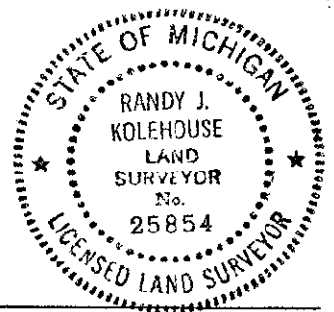

Signed by Randy J. Kolehouse
EARTH TECH

Date 8/21/95

Surveyor's Michigan License No. 25854