

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

## LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)


Located In:

Corner Code #



LIBER 1

PAGE 410

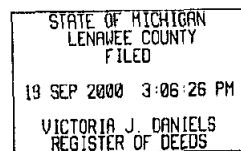

## 1. Public Land Survey

T-6-S R-3-E

G-11

T R

T R

T R

T R

## 2. Property Controlling in Section

S T R

S T R

## 3. Miscellaneous Property in Sec

S T R

S T R

Register of Deeds Stamp &amp; File Number

## 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

## 5. Private Claims \_\_\_\_\_

I, Glenn E. Richard in a field survey on August 9, 2000 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

## A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824 John Mack D.S. Set post cor. Sec.'s 27, 28, 33 &amp; 34 W. Oak 14 N 34 E 12 Hickory 9 S 34 W 29

1884 James Blair Found stone 58 links east from center of east end of bridge.

Prior to 1961 a survey by Walter Frazier of Tipton Hwy. from Country Club Rd. north to bridge shows the corner east of the bridge with witnesses but the plan doesn't show type of monumentation

1961 A new bridge was built east of the original one and the channel for Wolf Creek was straightened. The bridge was built by the Lenawee County Road Commission and it is believed they set a concrete nail on the bridge deck at the location of the corner.

1964 I found a concrete nail on the bridge deck witnessed it to the bridge abutments

NW corner of west abutment N 45° W 27.76, NE corner of east abutment N 50° E 32.31, SE corner of east abutment S 50° E 31.97, SW corner of west abutment S 45° W 27.39

1975 Kenneth Suydam found P.K. nail? and recorded it in Liber 3, Page 315, using my 1964 witnesses

1976 I found concrete nail on the bridge deck and recorded it in Liber 3, Page 428

1976 I found concrete nail on bridge deck

1987, 1988 &amp; 1989 Werner Sommer used PK nail for P.O.B. for Plats of Stoneridge No.1, No.2 and No.3

Distance between G-11 and H-11 is 2723.96 Blair's record=2723.16

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

August 9, 2000 Kevin Pickford P.S. 46682 replaced the P.K. with "Survey marker spike" Lenawee County Road Commission to place mon. box over the spike.

## C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Survey marker spike in bridge deck in monument box and is accepted as the best available evidence of the position of the original corner.

NW corner of west abutment N 45° W 27.76

NE corner of east abutment N 50° E 32.17

SE corner of east abutment S 50° E 31.94

SW corner of west abutment S 45° W 27.39

South edge of bridge deck South 13.38

North edge of bridge deck North 13.87

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 22, 2000Signed by Glenn E. Richard Date Sept 15, 2000

Glenn E. Richard

Surveyor's Michigan License No. 13040