

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee

(County)


Located in:

Corner Code #



LIBER 1

PAGE 412

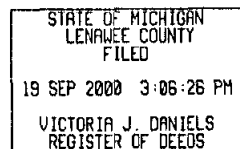

1. Public Land Survey T-8-S R-4-E C-3  
T R  
T R  
T R  
T R
2. Property Controlling S T R  
in Section S T R  
3. Miscellaneous S T R  
Property in Sec S T R

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Glenn E. Richard in a field survey on August 11, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1820 Joseph Wampler D.S. set post cor Sec.'s 5, 6, 7 & 8 Ironwood 9 S 84 E 9 Ironwood 14 N 4 E 22  
1891 James Blair found old stake. Placed bricks around old stake 4 links west of bogus corner. 16" Maple N 52 1/2 W .78 (51.48")  
Early 1900's J.L. Richard's record. stone pump and witnesses are same as James Blair.  
1914 J.L. Richard surveyed Hodges Hwy. Description of survey calls for stone @ S.E. corner Sec. 6  
1962 I dug and found stone pump & bricks and raised to surface with 1" X 3' iron bar thru the stone pump. Face of 36" Maple NW 50.6  
1963 I found 1" rod  
1972 I found 1" iron bar & recorded it in Liber 1 Page 121  
1974 Kenneth Suydam found 1" iron rod  
1977 I found 1" iron bar and recorded it in Liber 3, Page 532  
1985 I found 1" iron bar

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

August 11, 2000 Kevin Pickford P.S. 46682 found 1" X 36" iron rod driven thru the stone pump surrounded by bricks. The stone pump was cracked and broke when removing it. Set 5/8" X 36" re-rod with Lenawee County Re-mon cap stamped P.S. 13040. Replaced the pieces of the stone pump around the re-rod and set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and it accepted as a careful and faithful perpetuation of the position of the original corner.

Fd dbl hd nail & disc in E.P. N 20° E 108.12  
Added re-mon tag to Fd dbl hd nail & disc in E.P. N 80° E 124.68  
Cut "X" on S. end of CMP S 70° W 46.76  
SE corner of foundation house #3958 N 50° W 197.89

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 22, 2000

Signed by Glenn E. Richard Date Sept. 15, 2000  
Glenn E. Richard

Surveyor's Michigan License No. 13040