

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)

Located In:


Corner Code #



LIBER 1

PAGE 414

1. Public Land Survey T-8-S R-4-E C-9
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec S T R

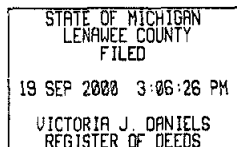

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

I, Glenn E. Richard, in a field survey on September 7, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1820 Joseph Wampler set post corner Sections 19, 20, 29 & 30 Hickory 7 S 59° E 5 R. Oak 40 N 15 W 13
1878 Survey by G.E. Kedzie, County Surveyor, called for stone
1889 James Blair measured to the Section corner from the north but didn't describe type of monumentation
1907 & 1914 J.L. Richard Found stake under stone
1953 Kenneth Suydam found a spike
1971 I found a boat spike and raised to the surface with a iron pipe
1973 I found the iron pipe & recorded it in Liber 2, Page 253
1998 I found 1/2" iron pipe and witnessed it prior to road re-construction


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

July 18, 2000 Found iron pipe which checked the one remaining witness over large blue stone 16" deep. Drilled thru the stone and set 5/8" X 3' re-rod.
September 7, 2000 Kevin Pickford P.S. 46682 recovered the 5/8" re-rod under base course of new asphalt pavement, capped with Lenawee County Re-mon cap stamped P.S. 13040 and set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

Dbl. hd. nail & re-mon tag in E.P. N 45° W 45.15
Dbl. hd. nail & re-mon tag in E.P. S 35° W 50.99
Cut "X" on top of CMP S 50° W 39.09
Cut "X" on top of CMP S 45° E 37.83

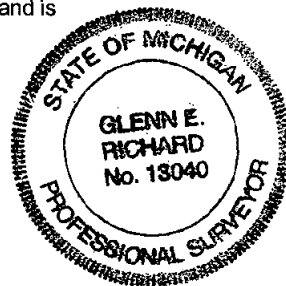

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 22, 2000

Signed by Glenn E. Richard Date Sept 15, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040