

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

## LAND CORNER RECORDATION CERTIFICATE

## SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)


Located In:

Corner Code #



LIBER 1

PAGE 418

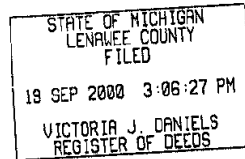

1. Public Land Survey T 9-S R 4-E C 1  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

Register of Deeds Stamp &amp; File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

I, Glenn E. Richard, in a field survey on September 8, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5		4	3		2	1					
3													
4	7	8		9	10		11	12					
5													
6	18	17		16	15		14	13					
7													
8	19	20		21	22		23	24					
9													
10	30	29		28	27		26	25					
11													
12	31	32		33	34		35	36					
13													

## A. Description of original monument and accessories and/or subsequent restoration:

GLO 1820 Joseph Wampler intersect N. Bldg. 161 lks (106.26") W. of post. Set post at intersection corner  
Sec. 5&6 R. Oak 18 N 26 W 23 Sugar 10 S 86 E 29  
1907 J.L. Richard survey notes "Found"  
1914 J.L. Richard Found stone  
1975 I dug and found iron pipe 6" deep 0.5 south of line between the SE corner & the S 1/4 corner of  
Section 31, T8S, R4E. I recorded it in Liber 3, Page 301 with witnesses to a point 0.50 north of the found iron pipe  
1985 I set a 3/4" galv. pipe at the surface 0.52 north of the found iron pipe on line between the SE corner and the  
S 1/4 corner of Sec. 31, T8S, R4E.  
1995 Michael Bartolo found 3/4" iron pipe and recorded it in Liber 5, Page 253

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

July 18, 2000 Found 3/4" I.P. over stone. Drilled thru stone and set 5/8" X 3' re-rod in hole.  
September 8, 2000 Found 5/8" re-rod under base course of new asphalt pavement. Capped with Lenawee County  
Re-mon cap stamped P.S. 13040 and set monument box.

## C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod thru stone with Lenawee County Re-mon cap stamped P.S. 13040 in monument box  
and is accepted as the best available evidence of the position of the original corner.

C-13 8-4 East 104.92  
SE corner of concrete porch #3994 North 43.43  
Dbl. hd. nail & re-mon tag in SE root 36" Maple N 35° E 86.40  
Dbl. hd. nail & re-mon tag in W. face E.P. N 40° W 196.09  
Fd. nail & disc in E. face 40" Maple S 20° W 79.03  
NE corner of conc. block building S 70° W 86.69



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 22, 2000

Signed by Glenn E. Richard Date Sept. 15, 2000  
Glenn E. Richard

Surveyor's Michigan License No. 13040