

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

5 Corners.

FOR CORNERS OF—	LOCATED IN—	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 45 N. R. 9 W.	B-8
2. PROPERTY CONTROLLING IN SECTION 19	T. 45 N. R. 9 W.	1-Sec.19 4-Sec.19 8-Sec.19 9-Sec.19
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. S. R. W.	
4. LOT NO.	RECORDED PLAT	
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 11/10, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B-8 Center Corner of Section 19.
1-Sec.19 West 1/16, on North side of Section 19.
8-Sec.19 West 1/16 corner of Section 19.
9-Sec.19 East 1/16 corner of Section 19.
4-Sec.19 North-West 1/16 corner of Section 19.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

B-8 Corner placed at intersection of lines connecting opposite Quarter Corners.
1-Sec.19 Corner placed midway bet. Sec. Cor. to West and $\frac{1}{4}$ cor. East.
8-Sec.19 Corner placed midway bet. West $\frac{1}{4}$ Cor. and Center Corner.
9-Sec.19 Corner placed midway bet. Center Corner and East $\frac{1}{4}$ Corner.
4-Sec.19 Corner placed at intersection of North-West quarter section.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" Dep't cap at all corners, except 4-Sec.19
B-8 Bearings: 8" R. Pine, N16°W, 23.7' and 8" R. Pine, N40°E, 14.2'
Corner lies 23' South of E-W Pine Plantation.
1-Sec.19 Bearings: 8" R. Pine, S34°E, 17.8' and 8" R. Pine, S46°W, 16.4'
8-Sec.19 Bearings: 12" W. Pine, N31°W, 48.5' and 8" R. Pine, S86°E, 11.5'
9-Sec.19 Bearings: 8" W. Pine, S23°E, 44.2' and Corner lies 330' East of Pine plantation corner.
4-Sec.19 MONUMENT: 36" T Iron.
Bearings: 8" R. Pine, N7°E, 41.5' and 8" R. Pine, N72°E, 51.4'


SIGNED BY Billy D. Buckler DATE 1/17/77

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

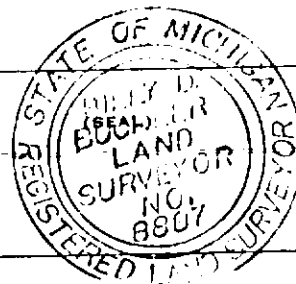

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET