

FEB 23 2001

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Luce County Remonumentation Corner

SECTION

For corners in

Luce County Located in: Corner Code #

1. Public Land Survey T45N R10W L-7
T R
T R
T R

2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. , Recorded Plat
5. Private Claims

LUCE COUNTY
REGISTER OF DEEDS
Recorded

Lib 3 Page 971
02-12-2001 09:49:01

Kathy S. Mahar, Register
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on October 18, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

L-7 1/4 Corner Common to Sections 13 & 24, Town 45 North, Range 10 West.

1849 - Original corner established by William Ives.

Witnesses: Beech 6, N63°E 23 links - Yellow Birch 5, S18°W 12 links.

Found no evidence of subsequent restoration of this corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being reestablished as part of the Luce County Remonumentation Program.

Found no evidence of the original corner, the location falls in a several hundred acre operating potato farm.

Reestablished corner by single proportionate measurement midway on line between the Section corner at K-7 to the west and the Section corner at M-7 on the range line to the east.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed a 1/2" x 18" rebar with a stamped aluminum Luce County Remonumentation cap approximately 40" below the ground surface at the corner location, which falls in a cultivated potato farm field. Corner is 660± south of an east-west 2 track road running through said potato farm. No nearby witness objects are available.

Witnesses:


Iron Pipe with aluminum DNR cap at Southwest corner Section 13, T45N, R10W, N89°32'21"W 2650.22'

Iron Pipe at Southeast corner Section 13, T45N, R10W, S89°32'21"E 2650.22'

1/2" Iron with cap #27447 in monument box at West 1/4 corner Section 13, T45N, R10W, N44°32'37"W 3746.83'

1/2" Iron with Luce County Remonumentation cap at East 1/4 corner Section 13, T45N, R10W, N45°22'37"E 3723.44'

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

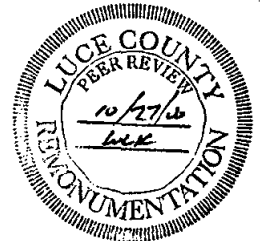

Signed by Keith R. Waters

Date 12-29-00

Surveyor's Michigan License No. 33142

