

REMONUMENTATION

APR 28 1995

COMMISSION

LUCE COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Luce

(County)

Located In:

Corner Code #

1. Public Land Survey
 2. Property Controlling in Section
 3. Miscellaneous Property in Sec.
 4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

45N 12W
 T R
 T R
 T R
 T R
 S T R
 S T R
 S T R
 S T R

K/L-7

#7

Filed 1/20 A.D., 1995

At 12:30 o'clock P.M.

Liber 2
File No. page 595Seth S. Mahan
Luce County Reg. of Deeds

Register of Deeds Stamp & File Number

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|----|----|----|----|----|---|---|---|---|---|---|---|
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | | |
| 3 | | | | | | | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | | |
| 5 | | | | | | | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | | |
| 7 | | | | | | | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | | |
| 9 | | | | | | | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | | |
| 11 | | | | | | | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | | |
| 13 | | | | | | | | | | | | | |

William L. Karr

December 19

94

I, _____, in a field survey on _____, 19____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 (K/L-7) Meander Corner Sections 13 & 24, T.45 N., R.12 W.

1849: G.H. Carleton set meander post 12" Beech S58W 16 lks
 16" Hemlock N78W 30 lks

1986: Eino Sanio, P.S. 7873 (Pg. 92 of Survey Records), shows Section line extending East from Section corner, but does not show the Meander corner. He surveyed a parcel 133' North of the section line.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (K/L-7) This corner is being perpetuated as part of the Luce County Remonumentation program.


Found a bent t-iron in centerline of gravel road 28' West of the edge of water, and 33' North of an East-West R.O.W. fence. Corner falls 133.0' South of Sanio survey to North. Replaced t-iron with 1/2"x 24" iron and aluminum "Luce County Remonumentation" cap.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(K/L-7) Witness Corner to the Meander Corner (W.C.M.C.)

Corner is a 1/2"x 24" iron with aluminum "Luce County Remonumentation" cap. in centerline of gravel road to West and 33' North of East-West fenceline. Corner falls 28' West of edge of water.

| | | |
|----------------------|-------|--------|
| Witnesses: 12" Maple | N02°W | 34.40' |
| 12" Maple | S24°E | 39.56' |
| 6" Maple | S39°W | 73.82' |
| 10" Maple | N45°W | 44.86' |

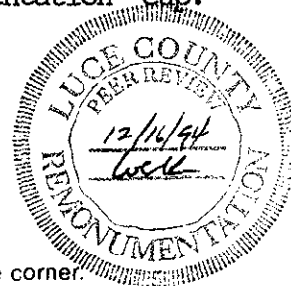

Signed by

William L. Karr

Date

12/22/94

Surveyor's Michigan License No. 27450

NOTE: Bearings are Compass bearings corrected for declination. APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 Distances are to a nail in side of witness objects unless noted. REVISED MAY 14, 1975
 REVISED JAN., 1983