

# SURVEY & REMONUMENTATION

FEB 26 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

FILED

For corners in

LIVINGSTON  
(County)

Located In:

Corner Code #

1. Public Land Survey

T4N R3E K-05

T R

T R

T R

2. Property Controlling  
in Section

S T R

S T R

3. Miscellaneous  
Property in Sec.

S T R

S T R

2000 SEP 28 1A 9:18

NANCY HAVILAND  
REGISTER OF DEEDS  
LIVINGSTON COUNTY, MI.  
48843

LSC #1288m

Register of Deeds Stamp & File Num

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

JACK K. SMITH, in a field survey on JULY 20, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L
2		6		5		4		3		2		1
3												
4		7		8		9		10		11		12
5												
6		18		17		16		15		14		13
7												
8		19		20		21		22		23		24
9												
10		30		29		28		27		26		25
11												
12		31		32		33		34		35		36
13												

A. Description of original monument and accessories and/or subsequent restoration:

GLO, SURVEY DATED: APRIL 15, 1825 BY S. SIBLEY  
GLO WITNESSES: MAPLE 8" N88°E 16.5'  
ELM 9" N87°W 9.24'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" REROD (WITH CAP #120943) 3.5 FEET TO THE SOUTHWEST OF A FENCE CORNER POST. THERE IS A NORTH-SOUTH TREE ROW AND FENCE 75 FEET TO THE WEST AND A TREE ROW 130 FEET TO THE NORTH GOING WEST. AT THE REROD THE OCCUPATION IS OF RECENT CONSTRUCTION AND THERE IS NOT OBVIOUS OLD SECTION LINE OCCUPATION.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


K-05: NORTHEAST CORNER OF SECTION 14, T4N-R3E, CONWAY TOWNSHIP, LIVINGSTON COUNTY, MICHIGAN.  
SET 1 1/4" X 36" STEEL PIPE WITH LIVINGSTON COUNTY REMON BRASS CAP # 35999.

N45°E SP & LIV. COUNTY REMON. TAG ON THE N.W. SIDE OF A 10" COR. POST 3.34'  
S30°W SP & LIV. COUNTY REMON. TAG ON THE WEST SIDE OF A 7" OAK 1.84'  
N45°W SP & LIV. COUNTY REMON. TAG ON THE WEST SIDE 8" ASH 12.98'  
EAST SP & LIV. COUNTY REMON. TAG ON THE NORTH SIDE OF A 18" OAK 49.97'

Signed by

Date JULY 20, 2000

Surveyor's Michigan License No. 35999

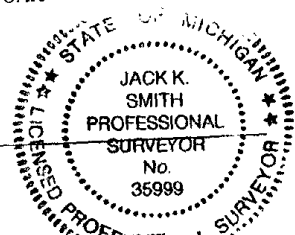

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 1983  
REVISED MAY 14, 1978  
REVISED JAN. 1983  
REVISED OCT., 1985

PA. 343 1980, APPROVED BY LIVINGSTON COUNTY  
FIRM GROUP ON 2-16-2000 CO. REP JED