

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

4 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>43</u> N. R. <u>10</u> W.	<u>B-8</u>
2. PROPERTY CONTROLLING IN SECTION <u>19</u>	T. <u>43</u> N. R. <u>10</u> W.	<u>8-Sec.19, 10-Sec.19</u> <u>11-Sec.19</u>
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. , RECORDED PLAT		
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-18&19, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B-8 Center Corner of Section 19.

8-Sec.19 West 1/16 Corner of Section 19.

10-Sec.19 South 1/16 Corner on West side of Section 19.

11-Sec.19 South-West 1/16 Corner of Section 19.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

B-8 Placed corner at intersection of lines connecting opposite quarter corners.

8-Sec.19 Placed corner by mean proportion between $\frac{1}{4}$ cor. to West and Center corner to East.

10-Sec.19 Placed corner midway bet. Sec. Cor. to South and 1/4 cor. to North.

11-Sec.19 Placed corner at intersection of lines quartering the quarter section.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminum cap at all four corners.

B-8 6" S. Maple, S9°W, 5.2' & 12" Twin R. Maple, N40°W, 34.6' & 10" Twin R. Maple, N39°E, 40.5'.

8-Sec.19 7" Cedar, N44°E, 11.0' & 7" Cedar, S53°W, 12.6' & 6" Cedar, N30°W, 11.9'.

10-Sec.19 7" Spruce, N10°E, 8.6' & 6" S. Maple, N69°W, 16.6' & 12" Spruce, S41°W, 15.7'.

11-Sec.19 No bearings available. Corner lies in southwest corner of large opening 3.0' West of N-S fence line.

SIGNED BY Billy D. Buckler DATE 10-9-80

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

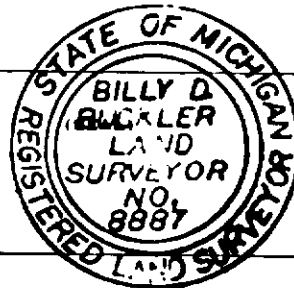

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET