

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MANISTEE
(County)

Located In:

Corner Code: #

1. Public Land Survey T 22N R 16W G-3
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. , Recorded Plat
5. Private Claims

REGISTER'S OFFICE
MANISTEE COUNTY
95-352 at 1:30pm
SEP - 7 1995
Sebrah Six, Sep
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, John Schulke, in a field survey on July 7th, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

In 1839, J. Brink (Deputy Surveyor) set a wooden post with the following corner references:

1. Beech 18" N43½°E 28 lks.
2. Beech 10" S14°E 38 lks.

In 1960, W. Downey (State Hwy. Dept.) used corner to restore G-4 (1/4 corner between Sections 9 & 10). No references or record of evidence recovered.

In 1899, J.A. Millard did a survey in Section 3 and found iron pipe and said to have been set by Wm. Vincent (see Book A, page 139 and Book B, pages 4 and 5 in the Manistee Co. Register of Deed's Office). No references.

In 1906, H. Knight found corner and established the East 1/16th corner of Sections 4 and 9 (see Book B, pages 184 & 185 in the Manistee Co. Register of Deed's Office). No references.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

In 1994, found pk nail with shiner in center of Miller Road.

In July 1995, found a PK nail and shiner in center of road. References 1 and 2 not recovered.

Distance to other following corners.


- G-2 (East 1/4 corner of Section 4) 2642.45 ft. Jenema
G-4 (East 1/4 corner of Section 9) 2673.59 ft. Schulke
F-3 (South 1/4 corner of Section 4) 2616.82 ft. Schulke
North Sixteenth line fence running West 1337 ft.
No conflicting evidence found.

Corner — — — — —
according to the county plan adopted pursuant to P.A. 345 of 1990,
as amended, (being the State Survey and Remonument Act, MCL 54.261
et seq.). Date of Peer Review: SEP 5 1995

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Considering the PK nail to be the best available evidence of the perpetuated location of the government corner, replace PK nail with 2" dia.X30" galvanized pipe monument with a brass cap stamped to identify the corner and set in monument box. The following corner references:

3. Power pole N05°W 180.54 ft.
4. Power pole S40°W 167.06 ft.
5. Cedar 8" S84°E 30.50 ft. with 60-D spike on North
6. Power pole N24°E 187.45 ft. side of tree.
7. SW corner of house N60°E 116.18 ft.
8. NE corner of house foundation N58°W 286.28 ft.

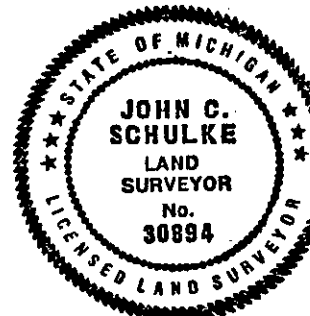

Signed by John C Schulke Date July 31, 1995

Surveyor's Michigan License No. RLS#30894