

SEP 30 1993

LAND CORNER RECORDATION CERTIFICATE


COMMISSION

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF-- LOCATED IN--  
1. PUBLIC LAND SURVEY T. 17N N. 15W E. S., R. W.  
2. PROPERTY CONTROLL- N. E. ING IN SECTION T. S., R. W.  
3. MISCELLANEOUS N. E. PROPERTY IN SECTION T. S., R. W.  
4. LOT NO. , RECORDED PLAT  
5. PRIVATE CLAIMS

CORNER CODE NUMBER

I-3

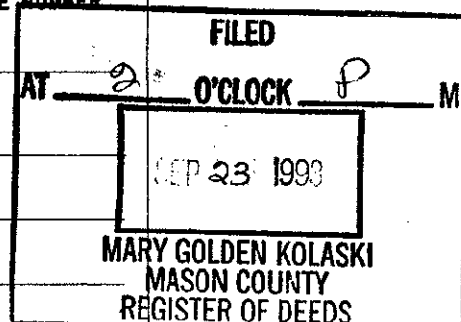

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on August 23 19 93, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on 19 , found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Section corner common to sections 2, 3, 10 and 11 of T17N R15W

1838 survey by John Hodgson  
Set Wood Post  
Pine 36 S42W 16 links  
W.Oak 6 N79E 17 links

Undated survey by K.B. Stephens  
Monument is an iron pin.  
B.Oak 16 N33 1/2E 64.6 feet  
Cor. Fn. Post S2 1/2W 33.0 feet

1972 survey by Robert A. Griffin  
Fd. a 1"x36" buggy axle from wits.  
replaced w/ a 5" sq.x 36" long  
conc. monu. w/brass cap.

1901 survey by R.O.Towns  
Fd. old stake  
P.Stp. 18 N9E 87 links  
W.Oak 6 S70E 41 links

1991 survey by Ken Ross  
Fd. conc. monu. by Griffin  
N1/4 10 N89-16-04W 2640.35 feet  
E1/4 10 S00-17-41W 2634.23 feet  
Recorded Liber 412 Page 176

W.Oak 5 N19E 87.47 feet  
P.Pole S62E 40.36 feet  
NE Cor cabin fndn. S26W 72.62'  
R.Pine 13 N8W 135.47 feet  
N1/4 10 N89-50-25W 2642.55feet  
N1/4 11 N89-29-15E 2632.63 feet

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the 5" square by 36" long concrete monument w/ brass cap by Griffin buried 6" beneath the surface in a monument box and 15.5 feet south of the centerline of the E-W pavement. Liber 1 Page 220 by Griffin documents the history of this corner. This monument is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Section corner common to sections 2, 3, 10 and 11 of T17N R15W

Monu. 5" sq. by 36" long concrete monu. with 3" brass disk was left in place.

Witnesses:

W.Pine 5 N33W 93.99'  
P.Post 4"x7' North 48.45'  
P.Post 8 South 16.12'  
P.Pole S61E 40.40'  
W.Oak 8 N19E 87.58'  
W.Oak 11 S12W 39.63'

Peer Group Reviewed  
and Approved  
Date: 9-16-93  
Kenneth L. Ross  
Mason County Surveyor


SIGNED BY Patrick R. Leemon DATE September 9, 1993

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

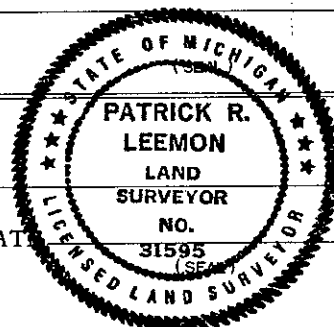

LIBER

3 PAGE 111

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_