

SURVEY &
REMONUMENTATION

APR 28 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MASON

(County)

Located In:

Corner Code: #

1. Public Land Survey

T 19N R 15W

L-11

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R


3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. , Recorded Plat

5. Private Claims

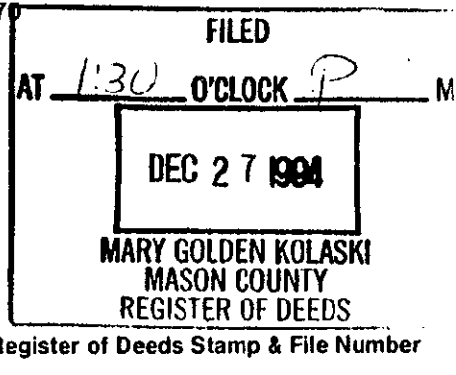

I, John C. Schulke, in a field survey on Dec. 8th, 19 94

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
In 1838, original survey established by Sibley.

Set a wood post with the following corner references:

1. W Oak 8" N73°E 10 lks.
2. Maple 8" S46°W 12 lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Kevin Pritchard and I, searched and found old cutting line running North and East from single proportional position between K-11 (see LCRC Liber 3, page 29) and M-11. Corner references # 1 and #2 was not recovered.

Restored corner by single proportional measurement.

K-11 N87°43'33"W 2657.01 ft.
M-11 S87°43'33"E 2657.01 ft. Grid Bearing and Distances.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 2"X30" long ID steel pipe with a brass cap stamped to identify the corner

RLS-16923 stamped on the monument, Position approved.

The following corner references:

- 12" B Oak S30°E 14.65 ft.
- 21" B Oak S30°W 8.21 ft.
- 4" clump of R Maple N64°W 17.13 ft.
- 7" Twin R Maple N14°E 23.67 ft.

NOTE: Corner is accepted as a careful and faithful restoration of the position of the original corner.

Signed by John C. Schulke Date Dec 5, 1994

Surveyor's Michigan License No. 30894

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

Peer Group Reviewed
and Approved

Date:

12-5-94

Kenneth L. Ross
Mason County Surveyor

LIBER 3 PAGE 253