

MAR 16 1998

LAND CORNER RECORDATION CERTIFICATE

SECTION

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF—:

LOCATED IN—:

CORNER CODE NUMBER

1. PUBLIC LAND SURVEY_____ T. 20N N. S., R. 15W E. W.
2. PROPERTY CONTROLLING IN SECTION_____ ,T. _____ N. S., R. _____ E. W.
3. MISCELLANEOUS PROPERTY IN SECTION_____ ,T. _____ N. S., R. _____ E. W.

B1

Seg. 2

4. LOT NO. _____ , RECORDED PLAT _____

5. PRIVATE CLAIMS _____

FILED

AT 10:10 O'CLOCK a

NOV 17 1994

MARY GOLDEN KOLASKI
MASON COUNTY
REGISTER OF DEEDS

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on October 30 1994, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Closing North Quarter Corner of section 6 of T20N R15W

This corner was not est. by GLO

1918 survey by C.E. Mitchell

No monument mentioned

#1 Oak 9 N49W 77 links

#2 Oak 13 N70E 93 links

1972 survey by Robert A. Griffin #13584

Fd. wit. #2 from County Surveyor C.E. Mitchell. Set a 5" sq. by 36" long conc. monu. w/ brass cap.

#3 W.Oak 7 S36E 83.15 feet

#4 W.Oak 5 S7E 69.88 feet

#5 P.Post 4 South 33.10 feet

#6 B.Oak 8 S41W 89.96 feet

#7 S1/4 32 T21N R15W west 244.00 ft.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the 5" square by 36" long concrete monument w/ brass cap by Griffin buried 3" beneath the surface and 10 feet North of the centerline of the E-W road. Witnesses 1, 2 and 5 are gone. Witness 3, 4, 6 and 7 are in good condition. Liber 1 Page 79 by Griffin documents the history of this corner. I could find no conflicting information that would lead to another location. I therefore accept the found monument as the best available evidence of the position of the corner. The corner is of the centerline of FR 8365 to the south.

Peer Group Reviewed
and Approved
Date: 11-16-94
Kenneth L. Ross

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Closing North Quarter Corner of section 6 of T20N R15W

Monu. The 5" square by 36" long concrete monu. with 3" brass disk was left in place.

Witnesses:


Rebar 5/8" x 24" N42W 61.66 feet

Rebar 5/8" x 24" N51E 69.15 feet

W.Oak 10 S36E 83.15 feet (#3)

W.Oak 9 S7E 69.81 feet (#4)

B.Oak 12 S41W 89.96 feet (#6)

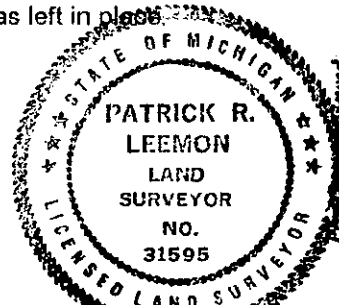

and Approved
Date: 11-16-94
Kenneth L. Ross
Mason County Surveyor

SIGNED BY Patrick R. Leemon

DATE October 30, 1994

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ CHIEF OF SURVEY PARTY

DATE _____

APPROVED AND SIGNED BY _____ MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

LIBER

3 PAGE 198

SURVEYOR'S MICHIGAN REGISTRATION NO. _____